

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

HOBBBS OFFICE O. G. C.
NEW MEXICO OIL CONSERVATION COMMISSION: C.
JUN 17 9 50 AM '69

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. E-605
7. Unit Agreement Name
8. Farm or Lease Name State AW
9. Well No. 1
10. Field and Pool, or Wildcat Dean Devonian
12. County Lea

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-
2. Name of Operator Cities Service Oil Company
3. Address of Operator P. O. Box 69 - Hobbs, New Mexico 88240
4. Location of Well UNIT LETTER 0 660 FEET FROM THE South LINE AND 1980 FEET FROM THE East LINE, SECTION 35 TOWNSHIP 15S RANGE 36E NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 3850 GR

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☒
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 13700, PSTD 10607. The above well was plugged and abandoned in the following manner: Pulled rods and tubing, set BOP. Plugged Wolfcamp perforations by setting cast iron bridge plug on wire line @ 10615' in 5½ inch casing and dumping one sack cement on top of CIBP from 10615 to 10607. Preparing to cut off 5½' casing. Loaded hole with fluid. Cut off head, and welded on lift nipple. Rigged up jacks. Shot 5½' csg. off @ 5500'. Worked pipe loose and started laying down. Pulled 126 joints 5½' csg. (5511.24') Started in hole with tubing to set plugs. Displaced 30 sack plug thru 2 3/8" EUE tbgs., ½ in and ½ out 5½' stub 5551-5460. Displaced 25 sack plug thru 2 3/8" EUE tbgs., ½ in and ½ out of 8 5/8" shoe 4949-4870'. Set 10 sack cement plug in top of 8 5/8" from G.L. to 30' and set 4" pipe marker.

Location will be cleaned of all equipment and debris - all pits will be filled and levelled.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

ORIGINAL SIGNED
G. D. ROBERTSON

SIGNED

TITLE **District Admin. Manager**

DATE **June 16, 1969**

APPROVED BY **John W. Runyan**
CONDITIONS OF APPROVAL, IF ANY:

TITLE **Geologist**

DATE

APR 20 1970