

NEW MEXICO OIL CONSERVATION COMMISSION

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State  Fee   
5. State Oil & Gas Lease No.  
E 565

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Atlantic Richfield Company	8. Farm or Lease Name Lea 758 State
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240	9. Well No. 1
4. Location of Well UNIT LETTER <u>D</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>36</u> TOWNSHIP <u>15S</u> RANGE <u>36E</u> NMPM.	10. Field and Pool, or Wildcat Dean-Permo Penn
15. Elevation (Show whether DF, RT, GR, etc.) 3849' GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIATION WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 13,005', PBD 11,190'. Present perms 10731-37'.  
13-3/8" csg set @ 305'. Cmt circ.  
9-5/8" csg set @ 4985' cmt w/2800 sx.  
5-1/2" csg set @ 11,675' cmt w/400 sx. TOC @ 8950'.

This well has declined in production to 2 BOPD and is beyond economic limits. No other zone of interest exists. To plug and abandon in the following manner: Set CIBP @ 10,630' w/35' cmt on top. Run free point on 5 1/2" csg & recover from free 5 1/2" csg. Set 50 sk cmt plug across 5 1/2" csg stub. Set 50 sk cmt plug across top of any exposed zones such as Tubbs 7673' or Glorieta 6522'. Set 50 sk cmt plug across 9-5/8" csg shoe 4935-5054'. Pull any free 9-5/8" csg as indicated by free point. Set 100 sk cmt plug across 9-5/8" csg stub. Set 100 sk cmt plug @ top of salt @ 2360'. Set 100 sk cmt plug across 13-3/8" shoe 360-238'. Set 10 sk cmt plug @ surface. Fill hole between all plugs w/heavy mud. Weld on plate and install regulation marker. Clean & level location.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Dist. Drlg. Supv. DATE 5/6/74

APPROVED BY Joe D. Raney TITLE Dist. I, Supv. DATE

CONDITIONS OF APPROVAL, IF ANY: