state of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

	•	
DISTRICT		
P.O. Box 1980.	Hobbs NM	28240

CONDITIONS OF APPROVAL, IF ANY:

N

OIL CONSERVATION DIVISION
P.O. Box 2088

WELL API NO.

P.O. Box 2006	30-025-03/36
TRICT II Santa Fe, New Mexico 87504-2088 Drawer DD, Ariesia, NM 88210	5. Indicate Type of Lease STATE FEE FEE
TRICT III O Rio Britos Md., Aziec, NM 87410	6. State Oil & Gas Lesse No. E 9335-S
SUNDRY NOTICES AND REPORTS ON WELLS OO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name
Type of Well:	STATE " T "
OE. GAS WELL OTHER TA	8. Well No.
BABER WELL SERVICING CO.	9. Pool same or Wildow
P.O. 80X 1772 Hobbs NM 88240	TOWNSEND PERMO UPPER PENN
Well Location 155	. WEST Line
Unit Letter N : 3300 Feet From The SOUTH Line and 155	feet From The WEST Line
	NMPM LEA County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	· * * * * * * * * * * * * * * * * * * *
Check Appropriate Box to Indicate Nature of Notice, R	Report, or Other Data
NOTICE OF INTENTION TO:	SEQUENT REPORT OF:
The transfer of the transfer o	ALTERING CASING
PENEDIAL WORK	☐ VEIEUNG MONG
REFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	
MPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING	G OPNS. PLUG AND ABANDONMENT
MPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING LL OR ALTER CASING CASING TEST AND COMMENCE DRILLING	G OPNS. PLUG AND ABANDONMENT
MPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING LL OR ALTER CASING CASING TEST AND CHANGE HER:	G OPNS. PLUG AND ABANDONMENT X
MPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING LL OR ALTER CASING CASING CASING TEST AND CHAR: Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inch	G OPNS. PLUG AND ABANDONMENT X
MPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING LL OR ALTER CASING CASING TEST AND CHARGE. Describe Proposed or Completed Operations (Clearly state all partinent details, and give partinent dates, inclusively) SEE RULE 1103.	G OPNS. PLUG AND ABANDONMENT X
MPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING LL OR ALTER CASING CASING TEST AND CHANGE HER: Describe Proposed or Completed Operations (Clearly state all partinent details, and give partinent dates, inclusively) SEE RULE 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400'	G OPNS. PLUG AND ABANDONMENT X
MPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING LL OR ALTER CASING CASING TEST AND CHANGE MER: Describe Proposed or Completed Operations (Clearly state all partinent details, and give partinent dates, inclusively) SEE RULE 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD	G OPNS. PLUG AND ABANDONMENT X
COMMENCE DRILLING LL OR ALTER CASING HER: Describe Proposed or Completed Operations (Clearly state all particular datails, and give pertinent dates, inche work) SEE RULB 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD 4. CUT AND LAID DOWN 4992' OF 5½ CASING	G OPNS. PLUG AND ABANDONMENT X
COMMENCE DRILLING LL OR ALTER CASING HER: Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclusively). SEE RULE 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD 4. CUT AND LAID DOWN 4992' OF 5½ CASING 5. SPOT 25 SKS CEMENT PLUG AT 6500' 6. SPOT 140 SKS CEMENT PLUG AT 5½ STUB 5050'AND WOC	G OPNS. PLUG AND ABANDONMENT X EMENT JOB
COMMENCE DRILLING LL OR ALTER CASING HER: Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclusively). SEE RULE 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD 4. CUT AND LAID DOWN 4992' OF 5½ CASING 5. SPOT 25 SKS CEMENT PLUG AT 6500' 6. SPOT 140 SKS CEMENT PLUG AT 5½ STUB 5050'AND WOC. 7. TAGGED PLUG AT 4927' SPOT W/60SKS CEMENT AND WOC.	G OPNS. PLUG AND ABANDONMENT X
COMMENCE DRILLING LL OR ALTER CASING HER: Describe Proposed or Completed Operations (Clearly state all partitions datails, and give partitions datas, inclusively) SEE RULE 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD 4. CUT AND LAID DOWN 4992' OF 5½ CASING 5. SPOT 25 SKS CEMENT PLUG AT 6500' 6. SPOT 140 SKS CEMENT PLUG AT 5½ STUB 5050'AND WOC 7. TAGGED PLUG AT 4927' SPOT W/60SKS CEMENT AND WOC 8. TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC	G OPNS. PLUG AND ABANDONMENT X EMENT JOB
COMMENCE DRILLING LL OR ALTER CASING HER: Describe Proposed or Completed Operations (Clearly state all partitions datails, and give partitions datas, inclusions) RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. TAGGED PLUG AT 9400' LOAD HOLE W/MUD CUT AND LAID DOWN 4992' OF 5½ CASING SPOT 25 SKS CEMENT PLUG AT 6500' SPOT 140 SKS CEMENT PLUG AT 5½ STUB 5050'AND WOC TAGGED PLUG AT 4927' SPOT W/60SKS CEMENT AND WOC TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC TAGGED PLUG AT 4618'	G OPNS. PLUG AND ABANDONMENT X EMENT JOB Luding estimated date of starting any proposed
COMMENCE DRILLING LL OR ALTER CASING HER: Describe Proposed or Completed Operations (Clearly state all partitions datails, and give partitions datas, inclusions) RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. TAGGED PLUG AT 9400' LOAD HOLE W/MUD CUT AND LAID DOWN 4992' OF 5½ CASING SPOT 25 SKS CEMENT PLUG AT 6500' SPOT 140 SKS CEMENT PLUG AT 5½ STUB 5050'AND WOC TAGGED PLUG AT 4927' SPOT W/60SKS CEMENT AND WOC TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC TAGGED PLUG AT 4618'	G OPNS. PLUG AND ABANDONMENT X EMENT JOB Luding estimated date of starting any proposed
COMMENCE DRILLING LL OR ALTER CASING HER: Describe Proposed or Completed Operations (Clearly state all particular datails, and give pertinent dates, inclusively) SEE RULB 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD 4. CUT AND LAID DOWN 4992' OF 5½ CASING 5. SPOT 25 SKS CEMENT PLUG AT 6500' 6. SPOT 140 SKS CEMENT PLUG AT 552 STUB 5050'AND WOC 7. TAGGED PLUG AT 4927' SPOT W/60SKS CEMENT AND WOC 8. TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC 9. TAGGED PLUG AT 4618'	G OPNS. PLUG AND ABANDONMENT X EMENT JOB Luding estimated date of starting any proposed
CASING TEST AND COMMENCE DRILLING LL OR ALTER CASING MER: Describe Proposed or Completed Operations (Clearly state all partinent details, and give partinent datas, inche work) SEE RULE 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD 4. CUT AND LAID DOWN 4992' OF 5½ CASING 5. SPOT 25 SKS CEMENT PLUG AT 6500' 6. SPOT 140 SKS CEMENT PLUG AT 5½ STUB 5050'AND WOC 7. TAGGED PLUG AT 4927' SPOT W/60SKS CEMENT AND WOC 8. TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC 9. TAGGED PLUG AT 4618' 10. SPOT 30 SKS CEMENT PLUG AT 2039' 11. SPOT 15 SKS CEMENT AT SURF AND SET UP P&A MARKER.	G OPNS. PLUG AND ABANDONMENT X EMENT JOB Luding estimated date of starting any proposed
COMMENCE DRILLING LL OR ALTER CASING HER: Describe Proposed or Completed Operations (Clearly state all parties at details, and give parties at data; inclusively SEE RULB 1103. 1. RUN TUBLING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD 4. CUT AND LAID DOWN 4992' OF 5½ CASING 5. SPOT 25 SKS CEMENT PLUG AT 6500' 6. SPOT 140 SKS CEMENT PLUG AT 5½ STUB 5050'AND WOC 7. TAGGED PLUG AT 4927' SPOT W/60SKS CEMENT AND WOC 8. TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC 9. TAGGED PLUG AT 4618' 10. SPOT 30 SKS CEMENT PLUG AT 2039' 11. SPOT 15 SKS CEMENT AT SURF AND SET UP P&A MARKER.	G OPNS. PLUG AND ABANDONMENT X EMENT JOB Inding estimated date of starting any proposed.
COMMENCE DRILLING LL OR ALTER CASING MER: Describe Proposed or Completed Operations (Clearly state all partisent details, and give partinent dates, inches work) SEE RULB 1103. 1. RUN TUBING TO 9518' AND SPOT W/25 SKS AND WOC. 2. TAGGED PLUG AT 9400' 3. LOAD HOLE W/MUD 4. CUT AND LAID DOWN 4992' OF 5½ CASING 5. SPOT 25 SKS CEMENT PLUG AT 6500' 6. SPOT 140 SKS CEMENT PLUG AT 5½ STUB 5050'AND WOC 7. TAGGED PLUG AT 4927' SPOT W/60SKS CEMENT AND WOC 8. TAGGED PLUG AT 4670' SPOT W/45 SKS CEMENT AND WOC 9. TAGGED PLUG AT 4618' 10. SPOT 30 SKS CEMENT PLUG AT 2039' 11. SPOT 15 SKS CEMENT AT SURF AND SET UP P&A MARKER.	G OPNS. PLUG AND ABANDONMENT X EMENT JOB Inding estimated date of starting any proposed.