

Submit 3 Copies To Appropriate District Office.
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-03737
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. E 9335-5
7. Lease Name or Unit Agreement Name: STATE T
8. Well No. 4
9. Pool name or Wildcat Townsend Permo Upper Penn

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Pronghorn Mgt. Corp.

3. Address of Operator
P. O. Box 1772 Hobbs, NM 88241

4. Well Location

Unit Letter K : 4620 feet from the South line and 1885 feet from the West line

Section 6 Township 16S Range 36E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3958'

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Circulate hole with mud laden fluid. POOH with tubing.
2. Nipple up to 5½" casing. Stretch, cut and pull 5501' casing.
3. Spot cement plug 50' in and out of stub. WOC - tag @ 5450'.
4. Spot 100' cement plug @ intermediate casing shoe. WOC - tag @ 4699'.
5. Spot 100' cement plug @ top of salt. WOC and tag @ 1920'.
6. Nipple up to 8 5/8" casing. Stretch, cut, and pull 503' casing.
7. Spot cement plug 50' in and out of stub. WOC - Tag @ 450'.
8. Spot 100' cement plug @ 13 3/8" shoe. WOC tag @ 325'.
9. Spot 10 sx surface plug. Erect dry hole marker. Clean location.

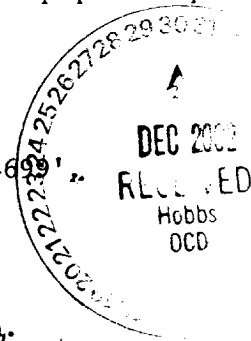

Loc 01-3-03 BGP

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Guy A. Baber TITLE PARTNER DATE 12/11/02

Type or print name Guy A. Baber Telephone No. 505-393-9176

(This space for State use)

APPROVED BY GARY W. WINK DATE JAN 03 2003
Conditions of approval, if any: QC FIELD REPRESENTATIVE II/STAFF MANAGER