

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
B-2411

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER: <u>Water Injection Well</u>	7. Unit Agreement Name <u>Lovington Paddock Unit</u>
2. Name of Operator <u>Texaco Producing Inc.</u>	8. Farm or Lease Name
3. Address of Operator <u>P. O. Box 728, Hobbs, NM 88240</u>	9. Well No. <u>13</u>
4. Location of well: UNIT LETTER <u>A</u> <u>880</u> FEET FROM THE <u>North</u> LINE AND <u>330</u> FEET FROM THE <u>East</u> LINE, SECTION <u>36</u> TOWNSHIP <u>16S</u> RANGE <u>36E</u> NMPM.	10. Field and Pool, or Wildcat <u>Lovington Paddock</u>
15. Elevation (Show whether DF, RT, GR, etc.) <u>3849' DF</u>	12. County <u>Lea</u>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

OTHER Repair Casing Leak ☒

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) MURU. Install BOP.
- 2) POH w/2 3/8" IPC tbg. and packer. (Howco R-3 @ 6086')
- 3) GIH w/4 3/4" bit and workstring. Tag TD. Clean out to TD @ 6279' if necessary.
- 4) GIH w/RBP and packer.
- 5) Set RBP @ +6100'. Pressure test to 500#.
- 6) Raise packer and locate casing leak.
- 7) Pull RBP and packer. Squeeze casing leak with CIBP and drillable cement retainer.
- 8) Drill out and test to 500#. Resqueeze if necessary.
- 9) Drill out CIBP.
- 10) TIH w/IPC tubing and packer. Test tubing in hole. Set pkr @ +6086.
- 11) Place on injection and obtain a stabilized test.

THE COMMISSION MUST BE NOTIFIED
24 HOURS PRIOR TO COMMENCING WORK

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. W. Browning

TITLE District Admin. Supervisor

DATE 03/21/86

**ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR**

APPROVED BY

TITLE

DATE

APR 2 - 1986

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

APR 1 - 1986

**CC-B
HOBBS OFFICE**