

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRICT	
SANTA FE	
FILE	
U.S.C.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.
B2411

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - 1" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

7. Unit Agreement Name

Lovington San Andres unit

8. Farm or Lease Name

Operator
Exaco producing Inc.

9. Well No.

5

Address of Operator
P. O. Box 728, Hobbs, NM88240

10. Field and Pool, or WHDCat

Lovington San Andres

Location of Well
UNIT LETTER A 660 FEET FROM THE North LINE AND 600 FEET FROM

THE East LINE, SECTION 36 TOWNSHIP 16S RANGE 36E NMPM.

12. County

Lea

15. Elevation (Show whether DF, RT, GR, etc.)

3846'

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

FORM REMEDIAL WORK ☒
TEMPORARILY ABANDON ☐
OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPMS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) MIRU. Pull rods & pump.
- 2) Install BOP. Pull tbq.
- 3) GIH w/4 3/4" bit. Tag TD.
- 4) GIH w/RBP TO +4600'
- 5) Pressure test csg to 500#. Repair if necessary.
- 6) GIH w/4 3/4" bit. Deepen from 5000 to 5125' (125').
- 7) Run GR-CNL-CAL-CCL 5125'-2500'. Pick perfs.
- 8) GIH w/pkr to +4500'. Load backside.
- 9) Acidize S.A. OH 5125-4625 w/10,000 gal gelled 15% NEFE in 3 stages. Use +1000# rocksalt in gelled brine between each stage as a block. Mix 2 drums scale inhibitor w/the acid. (5 BPM, 4000#).
- 10) Flow back load.
- 11) GIH w/RBP To +4610'.
- 12) Perforate GR w/4" csg gun w/2JSPI.
- 13) GIH w/pkr to +4300'.
- 14) Acidize GB perfs w/5000 gal gelled 15% NEFE and ball sealers. mix 1 drum scale inhibitor w/the acid (5 BPM, 4000#).
- 15) Flow back load.
- 16) Pull RBP
- 17) Place on production

Signature of Operator is true and complete to the best of my knowledge and belief.

Jerry Sexton TITLE District Admin. Supervisor DATE 10/09/86

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR

SIGNED BY _____ TITLE _____ DATE OCT 16 1986

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
OCT 15 1986
C.C.C.
HOBBS OFFICE