

Denton North Wolfcamp Unit Well No. 14-2

Plugging Procedure:

- 1) Run tubing to 8719' and load hole with 9.5# drilling mud. Pull tubing.
- 2) Shoot off 5 1/2" casing at 6100'. Pull casing.
- 3) Run tubing. Spot plugs as follows:
 - a. 30 sack cement plug from 6150' to 6050' (50' inside and 50' outside of 5 1/2" stub). Tag plug after 2 hours.
 - b. 50 sack cement plug from 4810' to 4710' (50' below to 50' inside of 8 5/8" casing). Tag plug after 2 hours.
 - c. 40 sack cement plug from 2200' to 2100'. Tag plug after 2 hours.
 - d. 10 sack cement plug from 31' to 3'.
- 4) Cut off casing 3' below ground and install permanent marker. Clean up location.

RECEIVED

MAY 24 1993

OCD HOBBS OFFICE