

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210DISTRICT III  
1000 Rio Brancos Rd., Aztec, NM 87410OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088WELL API NO.  
30-025-05137 ✓

5. Indicate Type of Lease

STATE ☐FEE ☒ XX

6. State Oil &amp; Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL  
WELL ☒GAS  
WELL ☐OTHER ☐

2. Name of Operator

S &amp; J OPERATING COMPANY

3. Address of Operator

P O BOX 2249, WICHITA FALLS, TEXAS 76307-2249

7. Lease Name or Unit Agreement Name  
(8910087370)DENTON NORTH WOLFCAMP UNIT  
TRACT 15

8. Well No.

3

9. Pool name or Wildcat  
DENTON WOLFCAMP

4. Well Location

Unit Letter G : 2145 Feet From The NORTH Line and 2145 Feet From The EAST LineSection 26 (SWNE) Township 14-S Range 37-E NMPM LEA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3813 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data  
NOTICE OF INTENTION TO:PERFORM REMEDIAL WORK ☐PLUG AND ABANDON ☒TEMPORARILY ABANDON ☐CHANGE PLANS ☐PULL OR ALTER CASING ☐OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ALTERING CASING ☐COMMENCE DRILLING OPNS. ☐PLUG AND ABANDONMENT ☐CASING TEST AND CEMENT JOB ☐OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

SHUT IN PRODUCING WELL. LAST PRODUCED 11-88. ON 3-30-92, SET CIBP AT 8688' AND  
DUMPED 35' OF CEMENT ON CIBP. CIRCULATED WITH SALT WATER TREATED WITH CORROSION  
INHIBITOR. ON 4-5-93, TESTED CASING AND LEAKED OFF. WILL PLUG AND ABANDON WELL.

\*SEE ATTACHED

RE COMMUNICATION FROM THE STATE OF NEW MEXICO  
RECEIVED BY THE STATE OF NEW MEXICO  
DIVISION OF MINERAL RESOURCES FOR THE 1993  
TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE MANAGER OF OPERATIONSDATE 5-10-93  
(817) 723-2166

TYPE OR PRINT NAME

PEYTON S. CARNES, JR.

TELEPHONE NO.

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON

DISTRICT I SUPERVISOR

APPROVED BY

TITLE

DATE

MAY 18 1993

CONDITIONS OF APPROVAL, IF ANY:

Denton North Wolfcamp Unit Well No. 15-3

Plugging Procedure:

- 1) Run tubing to 8653' and load hole with 9.5# drilling mud. Pull tubing.
- 2) Shoot off 5 1/2" casing at 6100'. Pull casing.
- 3) Run tubing. Spot plugs as follows:
  - a. 40 sack cement plug from 6150' to 6050' (50' inside and 50' outside of 5 1/2" stub). Tag plug after 2 hours.
  - b. 60 sack cement plug from 4774' to 4674' (50' below to 50' inside of 9 5/8" casing). Tag plug after 2 hours.
  - c. 50 sack cement plug from 2200' to 2100'. Tag plug after 2 hours.
  - d. Perforate 9 5/8" casing at 345' and break circulation to surface. Pump 200 sacks of cement and circulate to surface leaving 100' of cement in 9 5/8" casing.
  - e. 15 sack cement plug from 38' to 3'.
- 4) Cut off casing 3' below ground and install permanent marker. Clean up location.