

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30-025-05145
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name T.D. POPE
8. Well No. 10
9. Pool name or Wildcat DENTON DEVONIAN

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator COLLINS & WARE, INC.	
3. Address of Operator 508 W. WALL, SUITE 1200 MIDLAND, TEXAS 79701	
4. Well Location Unit Letter <u>P</u> : <u>660</u> Feet From The <u>SOUTH</u> Line and <u>660</u> Feet From The <u>EAST</u> Line Section <u>26</u> Township <u>14S</u> Range <u>37E</u> NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3805 GR	

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. TIH & SPOT 35' CMT ON CIBP @12,000'. PERFS (12,051-12,607'). CIRC HOLE W/10# MUD.
2. SET 50 SX PLUG @9200' (TOP OF WOLFCAMP @9198').
3. SET 50 SX PLUG @4900'. TAG PLUG (8 5/8" CSG @4840').
4. SET 35 SX PLUG @4650' (LINER TOP @4610'). - TAG
5. SET 35 SX PLUG @2200' (TOP OF SALT @2200').
6. SET 35 SX PLUG @500' (13 5/8" CSG SET @450'). - TAG
7. SET 10 SX SURFACE PLUG. CUT OFF WELLHEAD, WELD ON CAP & INSTALL P&A MARKER.
8. CUT ANCHORS & CLEAN LOCATION,

T.D.C. 5950? PERF 5900
542.50 IN + OUT

NOTE MUD BETWEEN ALL PLUGS.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Erick W. Nelson TITLE ENGINEER DATE 3-13-00
TYPE OR PRINT NAME ERICK W. NELSON TELEPHONE NO. (915) 687-3435

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL IF ANY

THE COMPLETION MUST BE NOTIFIED 24
HOURS BEFORE THE PLUGGING OR
CUTTING OFF THE WELLHEAD.

dp