

Denton North Wolfcamp Unit Well No. 13-7

Plugging Procedure:

- 1) Run tubing to 9265' and load hole with 9.5# drilling mud. Pull tubing.
- 2) Shoot off 5 1/2" casing at 6100'. Pull casing.
- 3) Run tubing. Spot plugs as follows:
  - a. 30 sack cement plug from 6150' to 6050' (50' inside and 50' outside of 5 1/2" stub). Tag plug after 2 hours.
  - b. 40 sack cement plug from 4800' to 4700' (50' below to 50' inside of 7 5/8" casing). Tag plug after 2 hours.
  - c. 30 sack cement plug from 2200' to 2100'. Tag plug after 2 hours.
  - d. 10 sack cement plug from 40' to 3'.
  - e. Run 1" tubing between 7 5/8" casing and 13 3/8" casing to 40' and cement to surface.
- 4) Cut off casing 3' below ground and install permanent marker. Clean up location.