

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO. 30-025-05189
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: T. D. Pope
8. Well No. 3
9. Pool name or Wildcat Denton Devonian

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Stephens & Johnson Operating Co.

3. Address of Operator
P O Box 2249, Wichita Falls, TX 76307-2249

4. Well Location
Unit Letter **P** : **660** feet from the **South** line and **660** feet from the **East** line
Section **35 (SE SE)** Township **14S** Range **37E** NMPM County **Lea**

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3813' KB

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Will plug and abandon this well. There is junk tubing and Reda pump cable in the hole from 5828' to TD. Tried unsuccessfully to fish this junk for 12 days in 1989 and lowered junk to 5828'.

See attached procedure.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE **Manager of Operations** DATE **7-1-02**

Type or print name **Peyton S. Carnes, Jr.** Telephone No. **940-723-2166**
(This space for State use)

APPROVED BY _____ TITLE _____ DATE _____
Conditions of approval, if any:

ORIGINAL SIGNATURE BY
GARY W. WILK
OG FIELD RECOVERED OCT 14/90 11:00 AM

JUL 30 2002

T. D. POPE WELL NO. 3

Plugging Procedure:

- 1) Run 5 1/2" cement retainer on tubing and set at 5800'.
- 2) Pump 350 sacks of cement below retainer, sting out of retainer and spot 25 sacks of cement on top of retainer.
- 3) Tag plug and load hole with 9.5# mud laden salt water.
- 4) Spot 50 sack plug 50' inside of 5 1/2" liner (4740') to 4460' inside of 8 5/8" casing. Tag plug.
- 5) Spot 30 sack plug at 3150' in 8 5/8" casing.
- 6) Spot 30 sack plug at 2200' in 8 5/8" casing.
- 7) Perforate 8 5/8" casing at 500' and circulate to surface with 400 sacks of cement leaving 8 5/8" casing full.
- 8) Cut off casing 3' below ground and install permanent marker.

ALCULATION AND DATA SHEET

CO-225 M (1-59)

UNIT S.D. Page
 FOR Eastern Devonian Field Study
 LOCATION S-35, T-14-S, R-37-E, Lea County, New Mexico
 SUBJECT S.D. Page #3

FILE NO. _____
 JOB OR AUTH. NO. _____
 PAGE _____
 DATE 7-13-77
 BY gary timlinson

3813' KB

