

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
7. Unit Agreement Name	
8. Farm or Lease Name <b>Denton</b>	
No. Wolfcamp Unit Tr 6	
9. Well No.	
27	
10. Field and Pool, or Wildcat	
Denton Wolfcamp	
12. County	
Lea	

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER **WIW**

2. Name of Operator  
**Mobil Oil Corporation**

3. Address of Operator  
**Suite 800, Three Greenway Plaza East, Houston, Texas 77046**

4. Location of Well  
UNIT LETTER **G**, **1980** FEET FROM THE **North** LINE AND **2180** FEET FROM  
THE **East** LINE, SECTION **35** TOWNSHIP **14-S** RANGE **37-E** NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)  
**3805 GR**

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

**P&A Procedures**

- (1) Set cement retainer at 9000' + and squeeze Wolfcamp perforations 9181-9206' w/150 sks. Class "H" cement
- (2) Circulate hole to mud laden fluid containing 25 x gel per 1000 bbls. water
- (3) Set C.I.B.P. at 6470' on wire line, set a cmt. retainer at 5320' to squeeze bad casing zone w/250 sx class "H" cmt.
- (4) Spot a 100' cmt. plug from 4850' to 4750' (25 sks min)
- (5) Spot a 100' cmt. plug from 2250' to 2150' (25 sks min)
- (6) Spot a 20' cmt. plug at surface w/10 sks.
- (7) Erect monument to clear location

*Expires 9/1/77*

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <i>[Signature]</i>	TITLE <b>Authorized Agent</b>	DATE <b>8-19-76</b>
APPROVED BY <i>[Signature]</i>	TITLE	DATE <b>AUG 24 1976</b>
CONDITIONS OF APPROVAL, IF ANY:		