	~1		
NO. OF COPIES RECEIVED			Form C-103
DISTRIBUTION	SU	2,	Supersedes Old C-102 and C-103
SANTA FE	NEW MEXICO OIL CON	ERVATION COMMISSION	Effective 1-1-65
FILE]	SERVATION COMMISSION 44 AM 365	·
U.S.G.S.	1	AN 20	5a. Indicate Type of Lease
LAND OFFICE	7	65	State X Fee
	_	G	5. State Oil & Gas Lease No.
OPERATOR	ــا		E-5677
			mmmmmm-
SUNDH	RY NOTICES AND REPORTS ON OPOSALS TO DRILL OR TO DEEPEN OF PLUG E	WELLS BACK TO A DIFFERENT RESERVOIR.	
USE "APPLICAT	TION FOR PERMIT - " (FORM C-101) FOR SUC	CH PROPOSALS.)	7 Unit Agramont Name
. OIL FET GAS			7. Unit Agreement Name
OIL GAS WELL	OTHER-		
2. Name of Operator			8. Farm or Lease Name
Secury W bil Oil Compa	ny, Inc.		New Max "K"
3. Address of Operator			9. Well No.
Dox 1800, Habbs, New Mexico			1
4. Location of Well			10. Field and Pool, or Wildcat
UNIT LETTER 660 FEET FROM THE North LINE AND 1980 FEET FROM			Doan Perme Penn
UNIT LETTER,	PEET FROM THE	CINE AND FEET F	
THE LINE, SECTION 5 TOWNSHIP 16 S RANGE 37 E NMPM			
THE LINE, SECTI	ONTOWNSHIP	RANGE NM	гм. (
	15. Elevation (Show whether	DF RT CR etc.)	12. County
	3845 GR	51 , K1 , OK, CICI ,	Ica
Check Appropriate Box To Indicate Nature of Notice, Report or Other Data			
NOTICE OF II	NTENTION TO:	SUBSEQUE	INT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANJON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON		COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT
PULL OR ALTER CASING	CHANGE PLANS	CASING TEST AND CEMENT JOB	₩.
		OTHER	Г
OTHER	ات ا		
17. Describe Proposed or Completed Or work; SEE RULE 1103.	perations (Clearly state all pertinent det	ails, and give pertinent dates, includ	ing estimated date of starting any proposed
slim hole box. Att Out paraffin @ 2200 on rods to 1500', r so 4100', milled or hrs. Rem 1 3/4" In ougs, worked the. I to 10,640'. Attempedate out of tool, pull stinger out of stuck @ 9780', free Dialog out 7" csg/ plus 6550-6412', sp Installed regulation	tempt to run socket to find pulled out of rope socked no rec., ran 2 prong grade fish 1 hr. Pulled shocked how Block on wire line, should down loose. Pulled to to squeeze perfs. 10,7 how to greeze perfs. 10,7 how to Billing out tog. 6 a 9740'. Cut tog. 6 9740'. Cut tog. 6 9740', could not pull. Potted 50 sx cement 5040-on monument. Well Pluggers asse is ready for inspect	ish for rods, stopped ocket. Pulled 25 jts. 25 to 4100', no rec. Range & ran 1 3/4" OS, no reshowed wire line. Pump tbg., rods & pump. Range 702-11,568' w/175 sx Trans. w/200 sx Trinity 10,583', tbg. stuck. 748' & pulled. Filled 1, cut @ 4933' & pulled 1, cut @ 4933' &	2450' in paraffin. 22" tbg. Ran 1 3/4" OS 1 1 3/4" WO shoe on rods rec. Ran mill, milled 12 200 900 bbl. water down 1 HOWCo. DC Ret. on tbg. 21 inity Inferno Neat, 22 inferno Neat. Could not 23 Ran free point, tbg. 34 hole w/mud laden fluid. 35 sected 25 sx cement 36 to surface.
13. I hereby certify that the information	n above is true and complete to the best	of my knowledge and belief.	
- 1 11			
SIGNED 2 H. Ken	TITLE C	Group Supervisor	DATE 7/20/65
1.	1 /1/		
Xoslan A.	(legar the		DATE
The state of the s	THE		
CONDITIONS OF APPROVAL, IF ANY	/ :		