

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2588

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
V-148	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P&A	7. Unit Agreement Name
2. Name of Operator Yates Petroleum Corporation	8. Farm or Lease Name Jacobs VJ State
3. Address of Operator 207 South 4th St., Artesia, NM 88210	9. Well No. 1
4. Location of Well UNIT LETTER P 660 FEET FROM THE South LINE AND 660 FEET FROM THE East LINE, SECTION 19 TOWNSHIP 16S RANGE 37E NMPM.	10. Field and Pool, or Wildcat Lovington Penn
15. Elevation (Show whether DF, RT, GR, etc.) 3824.6' GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged well as follows:

1. Pulled tubing, packer and RBP.
2. Set CIBP at 6300' w/35' cement on top.
3. Cut 5-1/2" casing at 5700' and pulled 133 joints (approximately 5683').
4. Plug #1: Spot 25 sx cement plug across stub, 50' in and 50' out. Tag cement at 5647'.
5. Plug #2: Spot 37 sx cement plug at 5045'. Tag cement at 5014'. Spot 2nd plug across 8-5/8" shoe w/35 sx cement. Tag cement at 4942'.
6. Plug #3: Spot 30 sx cement plug at 3100-3000'.
7. Plug #4: Spot 30 sx cement plug at 380-225'.
8. Plug #5: Set 10 sx cement plug at surface.

Install regulation marker. Surface will be restored. Heavy mud between plugs.

Verbal approval for plugging procedure given by Mr. Eddie Seay, NMOCD, Hobbs, 3-17-83.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED *[Signature]*

TITLE Production Supervisor

DATE 3-25-83

APPROVED BY

[Signature]

TITLE

OIL & GAS INSPECTOR

DATE

4-15-85

CONDITIONS OF APPROVAL, IF ANY: