

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-7

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	

USE: APPLICATION FOR PERMIT TO DRILL, REPAIR AND ABANDON

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Texaco Producing Inc.	8. Farm or Lease Name Lovington Paddock Unit
3. Address of Operator PO Box 728, Hobbs, New Mexico 88240	9. Well No. 10
4. Location of Well UNIT LETTER <u>B</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>2440</u> FEET FROM THE <u>East</u> LINE, SECTION <u>31</u> TOWNSHIP <u>16S</u> RANGE <u>37E</u> NMPM.	10. Field and Pool, or Wildcat Lovington Paddock
15. Elevation (Show whether DF, RT, GR, etc.) 3828' DF	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

REMEDIAL WORK ☒
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) MIRU 7/15/87. Install BOP.
- 2) Top of fish at 3087'. Recover fish and clean out to TD at 6260'.
- 3) GIH with 4 3/4" bit. Deepen to a new TD of 6290'.
- 4) Run GR-CNL-CCL-Caliper 6210'-3800'. Could not get 3 3/8" tool below 6210'. GIH with 4 3/4" bit to 6290'. Run 2 3/4" GR-CNL-CCL w/o caliper 6291'-6210'.
- 5) GIH with packer to 5900'. Acidize OH with 1000 15% NEFE. Flush with 6174 gallons gelled 40# 2% KCL. Pump 2000 gallon 15% NEFE in 2 stages with 1000# Rocksalt between stages. Pump 12000 gallons. 40# gel pre-pad followed by 5500 gallons 40# X-link gel with 1 ppg 20/40 sand, 5500 gallons with 2 ppg sand at 12 BPM, 6800#. On 2 ppg attempt to screen off. Flush with 1596 gallons gel.
- 6) GIH with 4 3/4" bit. Tag sand at 6210'. Wash to 6290'. Tag 170 Bbls. Tag TD at 6283'. Clean out to 6290'.
- 7) Run production equipment.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

397-3571

SIGNED J. A. Head
ORIGINAL SIGNED BY JERRY SIXTON
DISTRICT I SUPERVISOR

TITLE Hobbs Area Superintendent

DATE Aug. 6, 1987

AUG 11 1987

CONDITIONS OF APPROVAL, IF ANY:

DATE

RECEIVED
AUG 10 1987
OCD
HOBBS OFFICE

U.S. DEPARTMENT OF JUSTICE
FEDERAL BUREAU OF INVESTIGATION