

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM. 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO. 30-025-07287
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Knowles SWD
8. Well No. 2
9. Pool name or Wildcat San Andres SWDS

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER SWD	
2. Name of Operator Collins & Ware, Inc.	
3. Address of Operator 508 W. Wall, Suite 1200, Midland, Texas 79701	
4. Well Location Unit Letter P : 660 Feet From The South Line and 660 Feet From The East Line Section 34 Township 16S Range 38E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3713' DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 3/6/96 Dig 150 bbls flowback pit. Work 5 1/2" Lok-Set packer free.
- 3/7/96 Tag at 6010' and drill out scale from 6010' - 6404'.
- 3/8/96 Set packer at 6006' and acidize w/5000 gals 20% NEFE and 2250# rock salt with 2250 gals 10# brine.
- 8/11/96 TIH with 5 1/2" Lok-Set nickle coated packer, FL on/off tool w/1.50" profile, and 192 jts of IPC tubing (tubescope coating). Set packer at 5975'. Put 22,000# on slips. Pressure test annulus to 520 psi for 30 minutes. Held okay.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Dianne Sumrall TITLE Production Supervisor DATE 9/5/96

TYPE OR PRINT NAME Dianne Sumrall

TELEPHONE NO. (915) 687-3435

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

SEP 18 1996

JB