

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN THE  
(Other: Instruct  
verse side)

ICATE  
OR TO

Budget Bureau No. 1004-0135  
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

LC-029405B

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR  
Conoco Inc.

3. ADDRESS OF OPERATOR  
P.O. Box 460 - Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface

660' FSL & 660' FWL - Unit Letter M

14. PERMIT NO.  
30-025-08069

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

7. UNIT AGREEMENT NAME

MCA Unit

8. FARM OR LEASE NAME

MCA Unit Bty 1

9. WELL NO.

98

10. FIELD AND POOL, OR WILDCAT

Maljamar G-SA

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

20-17S-32E

12. COUNTY OR PARISH

Lea

13. STATE

NM

18. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and tools pertinent to this work.)

Work started 8/2/88. MIRR. G-1H & Tag at 3130'. G-1H w/ csg swedge & Swedge out csg from 3130'-37'. G-1H w/ grapple & catch fish at 3399'. POOH w/ fish. Swedge csg 3435'-45'. CO & jet wash 3588'-4014'. Ran OH caliper 3562'-4014'. Spot 12 bbl 15% HCL acid 3562'-4014'. Resin pack w/ 62 bbl. Tag resin at 3180' & pump add'l 38 bbl. DO resin from 3537'-4011'. Run 5 1/2" csg & set liner w/ 190 sxs of 50/50 Pozmix "C". DO cement 3964'-4008'. Perf 9th zone w/ 1 jsf 3950'-4000'. Acidize w/ 15% HCL-NE-FE. Perf 7th zone w/ 2 jsf 3830'-3862' & 1 jsf 3770'-90'. Trac 7th zone Perf 6th zone 3690'-3738' & acidize. CO to 4008'. Run producing equipment & place on production. Work completed on 9/8/88

liner 3298-3988

I hereby certify that the foregoing is true and correct

*[Signature]* D.F. FINNEY

TITLE Administrative Supervisor

DATE October 17, 1988

FOR APPROVAL OF STATE AGENCY

DATE OF APPROVAL

TITLE

ACCEPTED FOR RECORD

DATE

OCT 31 1988

\*See instructions on Reverse Side

CARLSBAD, NEW MEXICO