

NUMBER OF COPIES RECEIVED	
DISTRIBUTION	
SAN	
FILE	
U.S.G.S.	
LAND OFFICE	
TRANSPORTER	OIL
	GAS
PRODUCTION OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS NOTICES

strict Office, Oil Conservation Commission, before the work specified is to begin. A copy will be returned to the sender on which will be given the approval, with any modifications considered advisable, or the rejection by the Commission or agent, of the plan submitted. The plan as approved should be followed, and work should not begin until approval is obtained. See additional instructions in the Rules and Regulations of the Commission.

Indicate Nature of Notice by Checking Below

NOTICE OF INTENTION TO CHANGE PLANS		NOTICE OF INTENTION TO TEMPORARILY ABANDON WELL		NOTICE OF INTENTION TO DRILL DEEPER	
NOTICE OF INTENTION TO PLUG WELL	XX	NOTICE OF INTENTION TO PLUG BACK		NOTICE OF INTENTION TO SET LINER	
NOTICE OF INTENTION TO SQUEEZE		NOTICE OF INTENTION TO ACIDIZE		NOTICE OF INTENTION TO SHOOT (Nitro)	
NOTICE OF INTENTION TO GUN PERFORATE		NOTICE OF INTENTION (OTHER)		NOTICE OF INTENTION (OTHER)	

OIL CONSERVATION COMMISSION
SANTA FE, NEW MEXICO

Hobbs, New Mexico
(Place)

November 3, 1964
(Date)

Gentlemen:

Following is a Notice of Intention to do certain work as described below at the.....

Skelly Oil Company Marico "R" Well No. 1 in "A"
(Company or Operator) Lease (Unit)
NE 1/4 NE 1/4 of Sec. 18, T. 16-S, R. 35-E, NMPM., Hudson Penn. Pool
(40-acre Subdivision)
Lea County.

FULL DETAILS OF PROPOSED PLAN OF WORK

(FOLLOW INSTRUCTIONS IN THE RULES AND REGULATIONS)

The well is no longer economical to operate. There are no other commercial zones of oil or gas in this well. We plan to plug and abandon this well in the following manner:

1. Move in and rig up pulling unit.
2. Pull rods and tubing.
3. Spot 25 sack cement plug over 5-1/2" OD casing perfs. 10,705 - 10,725'.
4. Run free point indicator to locate top of cement behind 5-1/2" OD casing.
5. Rig down and move out pulling unit.
6. Move in and rig up Hydraulic Casing Puller.
7. Cut and pull 5-1/2" OD casing.
8. Rig down and move out Hydraulic Casing Puller.
9. Move in and rig up pulling unit.
10. Spot cement plugs as follows:
25 Sack cement plug over Tubb Zone 7394' if exposed after pulling 5-1/2" OD casing.
25 Sack cement plug over Glorietta Zone 6205' if exposed after pulling 5-1/2" OD casing.

(Continued on reverse side)

Approved....., 19.....
Except as follows:

Skelly Oil Company
Company or Operator

By.....
(ORIGINAL SIGNED) H. E. Aab

Position..... District Superintendent
Send Communications regarding well to:

Approved
OIL CONSERVATION COMMISSION

By.....

Name..... Skelly Oil Company

Title.....

Address..... Box 730 - Hobbs, New Mexico

25 sack plug in and out of cut off point on 5-1/2" OD casing.
25 sack cement plug at base of 9-5/8" OD casing at 4696'.
10 sack cement cap in top of 9-5/8" OD casing at surface and install 4" pipe marker.
11. All intervals not cemented will be filled with heavy mud laden fluid.