

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIP.
(Other instructions on reverse side)

Approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ *Injection*

2. NAME OF OPERATOR

Conoco Inc.

3. ADDRESS OF OPERATOR

P.O. Box 460 - Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
At surface

80' FNL & 25' FWL - Unit Letter D

14. PERMIT NO.

30-025-85019

15. ELEVATIONS (Show whether OF, RT, GR, etc.)

18.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

MIRU. POOH w/ producing equipment. G1H w/ bit & scraper to 3537'. POCH. Set cement retainer at 3503'. Pmpd 33 bbls cement slurry at 2 BPM at 1080', displace cement w/ 18 BFW, stung out of retainer & finish displacement w/ 2 BFW. POOH. Tag top of cement at 3435'. Drill out cement to 3461'. POOH. G1H w/ whipstock. Set at 3461'. Drill out to 3465'. Drill out to 3447'. Continue cutting window on whipstock. Drill out to 4050'. POOH. G1H w/ float equipment & 5 1/2" liner. Circ then shoe w/ 30 BFW. Pmpd 80 S4S. Bump plug w/ 1000'. Reverse 2 1/2 bbls cement off top of liner. POOH. G1H w/ bit & DC. to 3292'. Tag TOL. POOH. G1H to 4004'. DO float collar, 43' cement to shoe at 4050'. Circ clean. POOH. G1H w/ bit & 5 1/2" csg scraper to 4050'. POOH. Run GR-CCH Log. Perf 3813'-4018'. Set-plu at 3750'. Acidize w/ 55 bbls 15% HCL-NH-FE w/ 4 bbls checker sol dropping 2 ballsealers/bbl acid. Displace w/ 41 bbls filtered inj wtr. Flow back load. POOH. Perf 6th zone 3704'-3794'. Run producing equipment. For further info contact Barry at 397-5893

SIGNED *W. J. Finney*

TITLE Administrative Supervisor

DATE January 30, 1987

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE FOR RECORD

DATE

*See Instructions on Reverse Side

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

BLM-Chusad (4) REC (2) 2/1/87