

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. <u>30-025-85019</u>
5. Indicate Type of Lease <u>Federal</u> STATE ☐ FEE ☐
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER <u>Injection</u>	7. Lease Name or Unit Agreement Name <u>MCA Unit Bty. 2</u>
2. Name of Operator <u>Conoco Inc.</u>	8. Well No. <u>113</u>
3. Address of Operator <u>P. O. Box 460 - Hobbs, NM 88240</u>	9. Pool name or Wildcat <u>Maljamae G-5A</u>
4. Well Location Unit Letter <u>D</u> : <u>80</u> Feet From The <u>north</u> Line and <u>25</u> Feet From The <u>west</u> Line Section <u>23</u> Township <u>17S</u> Range <u>32E</u> NMPM <u>Lea</u> County	10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: <u>CO₂ Stage 1 - Convert to Producer</u> ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRAL. POOH w/ producing equipment. G1H w/ bit & scraper to 3537'. POOH. Set
Cement retainer at 3503'. Empd 35 bbls cement slurry at 2 BPM at 1080'.
displace cement w/ 13 BFW, string out of retainer & finish displacement w/ 2
BFW. POOH. Tag top of cement at 3435'. DO cement to 3461'. POOH. G1H w/
whipstock. Set at 3461'. DO to 3465' Continue cutting window on whipstock.
DO to 4050'. POOH. G1H w/ float equipment & 5 1/2" liner. Circ thru shoe w/ 30 BFW.
Empd 80 sks. Bump plug w/ 1000'. Reverse 2 1/2 bbls cement off top of liner. POOH.
G1H w/ bit & DCs to 3242'. Tag Top. POOH. G1H to 4004'. DO float collar, 43'
Cement to shoe at 4050'. Circ clean. POOH. G1H w/ bit & 5 1/2" cog scraper to
4050'. POOH. Run GR-CCs log. Perf 3813'-4018'. Set pks at 3750'. Acidize w/

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Administrative Supervisor DATE 1/31/89
TYPE OR PRINT NAME D. F. Finney TELEPHONE NO. (505) 397-5800

(This space for State Use)

FOR RECORD ONLY

APPROVED BY _____ TITLE _____ DATE FEB 07 1989

CONDITIONS OF APPROVAL, IF ANY:

MIRAL - Hobbs (3) File

RECEIVED

FEB 6 1989

REC'D FEB 6 1989

OCD
HOBBS OFFICE