

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. <u>30-025-20593</u>
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name <u>State 31</u>
8. Well No. <u>Northeast Haljeman Unit 1</u>
9. Pool Name or Fieldcat <u>W. Remnitz-WC</u>
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator <u>Dwight A. Tipton</u>
3. Address of Operator <u>Box 1597, Lovington, N.M. 88260</u>	4. Well Location Joint Letter: <u>0</u> : <u>660</u> Feet From The <u>South</u> Line and <u>1980</u> Feet From The <u>East</u> Line Section <u>31</u> Township <u>16S</u> Range <u>33E</u> NMPM <u>lea</u> County <u></u>
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. POH w/rods and tbgs. RU wireline unit, set CIBP @ 10,350'. ^{14 SACKS} TIH w/tbgs. to CIBP, load hole w/mud. POH to 7800', spot 25 sk. plug (ABO).
2. Free point casing, cut 4 1/2" @ 4426', attempt to work free. Shoot casing @ 3783'. Pull & load 122 jts.
3. Spot 80 sk. plug @ 4475'. WOC, tagged plug top @ 3775'.
4. RU wireline, shoot 8 5/8" casing @ 571', worked free. LD 18 jts. 8 5/8".
5. TIH to 727' spotted 85 sk. plug w/2% CaCl2. WOC. Tagged plug @ 496'. POH to 369', spotted 75 sk. Tagged top @ 263'.
6. Spot 10 sk. top plug.
7. Erect dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.A. Baber TITLE President DATE 12-13-90
TYPE OR PRINT NAME G.A. Baber TELEPHONE NO. 397-3502

(This space for State Use)

APPROVED BY Terry W. Hill TITLE OIL & GAS INSPECTOR DATE 12-13-90
CONDITIONS OF APPROVAL, IF ANY: