

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
OG-866

## SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- TA Well	7. Unit Agreement Name
2. Name of Operator Southland Royalty Company	8. Farm or Lease Name NE Maljamar Unit
3. Address of Operator 1100 Wall Towers West, Midland, Texas 79701	9. Well No. 3
4. Location of Well UNIT LETTER O 660 FEET FROM THE south LINE AND 1980 FEET FROM THE east LINE, SECTION 31 TOWNSHIP 16S RANGE 33E NMPM.	10. Field and Pool, or Wildcat Undesignated
11. Elevation (Show whether DF, RT, GR, etc.) 4241' GR	12. County Lea

### Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

### 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up. Run CIBP and set @ 10,350'. Cap with 35' cement.
2. Displace hole with 10# mud.
3. Cut 5 1/2" @ 10,100' and recover casing. Spot 100' plug across casing stub.
4. Spot 100' plug across 8 5/8" casing shoe @ 4409'.
5. Cut 8 5/8" @ 2500' and recover casing. Spot 100' plug across casing stub.  
(Note this plug will also cover base of salt @ 2465') Tag plug.
6. Spot 100' plug @ top of salt at 1450'. Tag plug.
7. Spot 100' plug @ 13 3/8" casing shoe @ 319'.
8. Spot 20' plug @ surface.
9. Clean location, install surface marker. Rig down.

CONTACT OCC FOR ADDITIONAL PLUGS WHEN 5 1/2" IS RATE PULLED

THIS IS A TRUE AND CORRECT COPY OF THE ORIGINAL FILED IN THE OFFICE OF THE DISTRICT ENGINEER FOR THE COUNTY OF LEA, NEW MEXICO.

### 18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>C. Harney Carr</u>	TITLE <u>District Engineer</u>	DATE <u>1-24-80</u>
APPROVED BY <u>Jerry Sexton</u> Dist. L. Supv.	TITLE <u>District Engineer</u>	DATE <u>JAN 28 1980</u>
CONDITIONS OF APPROVAL, IF ANY:		