

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

3-NMOCC  
1-Midland  
1-File  
2 - Atlantic Richfield

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR RE-ENTER OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT - (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	7. Unit Agreement Name
2. Name of Operator GETTY OIL COMPANY	8. Farm or Lease Name STATE "P"
3. Address of Operator P. O. BOX 249, HOBBS, NEW MEXICO 88240	9. Well No. 10
4. Location of Well UNIT LETTER <u>O</u> , <u>1980</u> FEET FROM THE <u>EAST</u> LINE AND <u>660</u> FEET FROM THE <u>SOUTH</u> LINE, SECTION <u>32</u> TOWNSHIP <u>16-S</u> RANGE <u>37-E</u> NMPM.	10. Field and Pool, or Wildcat LOVINGTON <i>Pool 1</i>
15. Elevation (Show whether DF, RT, GR, etc.) 3793.5 GR	12. County LEA

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Moved in casing pullers 6-30-76. Set CIBP on wire line in 5-1/2" casing @ 6100'. Dumped 35' of cement on top of plug back to 6065'. Mixed mud in 10# brine and circulated to surface. Shot 5-1/2" casing @ 2560'. Could not pull. Shot collar @ 2477'. Could not pull. Shut down and moved rig to Well No. 5. Rigged back up 7-17-76. Still could not pull. Ran 2-3/8" tubing to 2611'. Mudded up with gelled brine. Mixed 20 sack plug from 2611' to 2427'. (Shot @ 2477 and 2560') Shot 5-1/2" @ 1494' and pulled 5-1/2" casing. Layed 20 sack cement plug from 1547 to 1410'. Layed 12 sack cement plug in top of 8-5/8" casing. Installed 4" dry hole marker. Cleaned up location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED C. L. Wade ORIGINAL SIGNED BY: C. L. Wade TITLE AREA SUPERINTENDENT DATE July 26, 1976

APPROVED BY John R. [Signature] TITLE Geologist DATE July 26, 1976  
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

JUL 27 1976

G.L. CONSERVATION  
HONOLULU, O.H.