

WELL WORK RECOMMENDATIONS
Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: Bridges State Well No. #123

Field: Vacuum

County: Lea State: New Mexico

RECOMMENDED PROCEDURE:

1. Pull rods, pump, tubing
2. Spot 2-100' cement plugs above San Andres perms (500'-4500' w/60 sx) and salt top (1700'-1800' w/60 sx)
3. Circulate hole to mud using 25 sx gel per 100 bbls water (calculated volume = 212 bbls)
4. Set surface plug at top w/ 10 sx
5. Set monument and clear location.

Verbally reviewed w/ ~~Mr. J. C. G. / 1-11-73~~
NMOCC wants 24 hour notice on operations start.

JCG/1-11-73