

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-2262

5. Indicate Type of Lease.

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Reed

8. Well No.

1

9. Pool name or Wildcat

Morton (Wolfcamp)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL

WELL ☒

GAS

WELL ☐

OTHER

2. Name of Operator

Union Oil Company of California

3. Address of Operator

P. O. Box 671 - Midland, Texas 79702

4. Well Location

Unit Letter N : 766 Feet From The south Line and 2086 Feet From The west Line

Section 12

Township 15-S

Range 34-E

NMPM

Lea

County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4059.8' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11-30-89 thru 12-9-89

MIRU Pool Well Service. Install BOP. Set CTBP in 5 1/2 csg @ 10,200' on WL. RIH w/2 3/8" tbg. RIH w/5 1/2" mod "R" pkr, on 2 3/8" tbg. Tstd csg for leak, found same @ 5900-5600', 800-600'. POOH w/pkr. RIH w/2 3/8" tbg open ended to 10,200'. Displ hole w/10# mud. Sptd 15 sxs "C" cmt from 10,200-10,020'. PUH w/tbg & sptd 24 sx "C" cmt from 8,100-7800'. PUH w/tbg & sptd 50 sx "C" cmt f/5900-5308'. POH w/tbg. Weld on 5 1/2" pull nipple. PU csg & remove slips. Freepoint 5 1/2" csg @ 4340' by stretch. Shoot 5 1/2" csg @ 4290'. POH, LD 5 1/2" csg. Spot 40 sxs "C" cmt f/4340-4217'-WOC 4 hours. Tag cmt plug @ 4217'. POOH. Weld on 8 5/8" pull nipple, run free point-free @ 1000'. Cut 8 5/8" csg @ 879'. Pull & lay down 27 jts & 1 pc of 8 5/8" csg. RIH w/ 2 3/8" tbg open ended to 930'. Spot 60 sxs "C" cmt w/2% CaCl f/930-730'. WOC 4 hrs. RIH & tag cmt @ 730'. PU to 404'. Spot 60 sxs "C" cmt f/404-298'. Tag cmt plug @ 298'. POOH to 30'-spot 10 sxs cmt f/30' to surf. Cut off well heads. Weld on P&A plate-install dry hole marker-well P&A'd 12-9-89. Clean location. RDPU.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Bobby Bryan

TITLE Drilling Superintendent

DATE 12-13-89

TYPE OR PRINT NAME Bobby Bryan

TELEPHONE NO. (915) 682-9731

(This space for State Use)

APPROVED BY

Edward Smith

TITLE

OIL & GAS INSPECTOR

DATE

SEP 14 1989

CONDITIONS OF APPROVAL, IF ANY: