

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 South First, Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-105  
Revised March 25, 1999

OIL CONSERVATION DIVISION  
2040 South Pacheco  
Santa Fe, NM 87505

WELL API NO. <b>30-025-24550</b>
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name:  <b>Goodrich Com</b>
8. Well No.  <b>#1</b>
Pool name or Wildcat <b>Austin Wolfcamp, Southwest</b>

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other	
2. Name of Operator <b>Harvey E. Yates Company</b>	
3. Address of Operator <b>P.O. Box 1933, Roswell, New Mexico 88201 505-623-6601</b>	
4. Well Location  Unit Letter <b>F</b> : <b>1980</b> feet from the <b>North</b> line and <b>1980</b> feet from the <b>West</b> line  Section <b>11</b> Township <b>15S</b> Range <b>35E</b> NMPM <b>Lea</b> County	
10. Elevation (Show whether DR, RKB, RT, GR, etc.) <b>3976' GR</b>	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

4/05/2000

Set CIBP @ 10,250'. Spot 25 sxs on top. TOC 10,010'.

4/10/2000

Pull 5500' of 5 1/2" casing.

4/11/2000

Spot 25 sxs @ 8216'-7976'. Spot 100 sxs @ 6208'-5468' tagged.

4/12/2000

Spot 25 sxs @ 5468'-5376' tagged. Spot 50 sxs @ 4755'-4633' tagged.

4/13/2000

Spot 35 sxs @ 1976'-1841'. Perforate @ 437'. Squeeze 110 sxs - tag @ 332'

4/14/2000

Spot 10 sxs @ 30'-surface.  
Install dry hole marker. Circulate 10# mud.  
P&A complete.

Approved as to plugging of the Well Bore.  
Liability under bond is retained until  
surface restoration is completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Dianna Rodgers TITLE Production Analyst DATE 4/20/2000

Type or print name Dianna Rodgers Telephone No. 505-623-6601  
(This space for State use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
Conditions of approval, if any:

to CWW

APR 2000  
A  
Received  
Hobbs  
OCD