				-+-		
_	State of New Mex			Form C-103		
Submit 3 Copies to Appropriate District Office	Energy nerals and Natural Res		Revised 1-1-89			
DISTRICT	OIL CONSERVATION	N DIVISION	WELL API NO.			
P.O. Box 1980, Hobbs, NM 88240 P.O. Box 2088			30-025-25031			
DISTRICT II Santa Fe, New Mexico 87504-2088 P.O. Drawer DD, Artesia, NM \$8210			5. Indicate Type of Lesse STATE FEE			
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410			6. State Oil & Gas Lease No.			
SUNDRY NOTICES AND REPORTS ON WELLS						
SUNDRY NOT (DO NOT USE THIS FORM FOR PRO DIFFERENT RESEI (FORM C	7. Lease Name or Unit Agreement Name					
1. Type of Well: Oil X WELL	OTHER	West Knowles				
2 Name of Operator			8. Well No.			
CIMARRON EXPLORATION	No. 5 9. Pool same or Wildcat					
3 Address of Operator	Knowles Drinkard, West					
P.O. Box 1592, Roswell, N	lew Mexico 88202-1592	·				
4. Well Location Unit Letter H : 1980 Feet From The North Line and 660 Feet From The East Line						
Section 34	Township 16-S Rai		NMPM	Lea County		
10. Elevation (Show Whether Dr., Nr.D., Nr., Ch, and						
3,772 GR						
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data SUBSEQUENT REPORT OF:						
NOTICE OF IN	TENTION TO:					
		REMEDIAL WORK		ALTERING CASING		
	CHANGE PLANS	COMMENCE DRILLIN		FLOG AND ADAMO STANDAR		
	· ·	CASING TEST AND C	CASING TEST AND CEMENT JOB			
OTHER:	·	OTHER:				
12. Describe Proposed or Completed Ope	rations (Clearly state all pertinent details, a					
27-May-99 MIRU PU. COH and tools and TIH for fish. casing inspection log. Set 3060. Set retainer @ 2710 test to 500#. DO CIBP and TBIH to mill and swedge tig 100 sx Class C with 2% Ca hole clean to 8345. TOH w packer fluid and prepare to	I with pump and rods. Run free-p Swedge and mill tight spot at 289 CIBP at 8150 (by wireline). TIH w and squeeze 300 sx lead and 10 clean out to 8340. TOH with too pht spot at 2890. Set CIBP at 499 CI tail. WOC for 18 hrs. Drill out ith tools and PU packer. Test 2-3 acidize Drinkard perfs. Spear af Well went on a vacuum at shut pin to swab back load water. RD n on 13-Jun-99.	vith packer and test c 0 sx tail. Circ. out 9- ls, PU treating packe 8 and retainer at 267 & test to 600#. Dres 3/8" tbg. back in hole nead 300 gal. xylene.	asing. Found ba 5/8" casing. WC r and TBIH to tig 6. Squeeze 100 s off bad spot ar 9. Set pkr. at 815 Acidize with 25 v 1-1/2 brs. BU	ad spots at 2890 and) cmt 48 hrs. Drill out & ht spot. PU tools and) sx thixotropic lead and id drill out CIBP. Circ. 4'. Load backside with 00 gal. 15% NeFe. Flush swab and swab back		

 $\cdot \uparrow$

I hereby certify that the information above is the and complete to the bear of skinkature	my knowledge and belief.	Vice President	07/20/99 date(505) telephone no. 623-9799
CRIGINAL SIGNED BY (This space for State UR) GARY WINK FIELD REP. II	TTLE		JUL 2 7 1998
APPROVED BY			C