

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Enr Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-25324
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No. 16274
7. Lease Name or Unit Agreement Name North Eidson Fee
8. Well No. 1
9. Pool name or Wildcat Eidson Morrow, North
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4075' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER
2. Name of Operator CHISOS OPERATING, INC.
3. Address of Operator P. O. Box 10856, Midland, Texas
4. Well Location Unit Letter M : 660 Feet From The South Line and 660 Feet From The West Line

Section 34 Township 15S Range 34E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3/24/92 Set CIBP @ 12,685'. Dumped 4 sxs cmt. from 12685'-12650'.
Set CIBP @ 11,932'. Dumped 4 sxs cmt. from 11932'-11896'.
3/26/92 Spotted 30 sxs. cmt. from 9000'-8750'.
Spotted 30 sxs. cmt. from 6200'-5950'.
Cut 5-1/2" Csg. @ 4600'.
3/27/92 Spotted 65 sxs. of cmt. from 4650'-UP.
3/28/92 Tagged cmt. @ 4385'. Spotted 30 sxs. cmt. from 1700'-1550'. Circulate cmt. to surface. Cut off wellhead. Put 15 sxs. of cmt. in surface pipe (13-3/8").
Installed Marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bobbie J. Miller TITLE Oil & Gas Analyst DATE 6/2/92
TYPE OR PRINT NAME Bobbie J. Miller TELEPHONE NO. 915 686-946

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE AUG 31 '92
CONDITIONS OF APPROVAL, IF ANY: