OF COPIES RECEIVED DIST RIBUTION SAL. A FE	NEW MEXICO OIL CONSI	ERVATION COMMISSION	Form C-103 Supersedes Old C-102 and C-103 Effective 1-1-65	
U.S.G.S. LAND OFFICE OPERATOR			Sa. Indicate Type of Lease State X Fe- S. State Oil & Gas Lease N	e [
SUNDRY	NOTICES AND REPORTS ON	WELLS		
(DO NOT USE THIS FORM FOR PROPO USE "APPLICATION 1.	SALS TO DRILL OR TO DEEPEN OR PLUG BAN FOR PERMIT — (FORM C-101) FOR SUC	ACK TO A DIFFERENT RESERVOIR. H PROPOSALS.)	7. Unit Agreement Name	7]]]
well X GAS WELL 2. Name of Operator	OTHER-		8, Farm or Lease Name	
W. A. Moncrief, Jr.			Phillips State	
3. Address of Operator Moncrief Building, Ninth at Commerce, Fort Worth, Texas 76102			9. Well No. 1-Y	
4. Location of Well			10. Field and Pool, or Wildcat	
UNIT LETTER I	675 FEET FROM THE South	LINE AND 625 FEET	Undesignated	111
THE <u>east</u> LINE, SECTION	8 TOWNSHIP 16S	RANGE 34E N	MPM.	
15. Elevation (Show whether DF, RT, GR, etc.)			12. County	<i>}}</i>
The Charles		148 KB	Other Data	7777
NOTICE OF INT	ppropriate Box To Indicate N FENTION TO:		ENT REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK COMMENCE DRILLING OPNS.	ALTERING CASING PLUG AND ABANDONM	ENT [
PULL OR ALTER CASING	CHANGE PLANS	CASING TEST AND CEMENT JOB		Γ
OTHER Whipstock and by-pa	ass fish X	OTHER		\
17. Describe Proposed or Completed Operwork) SEE RULE 1103. (1.) 8-5/8" csg colla	rations (Clearly state all pertinent dete apsed at 2095' on 2-20-			
continued to dr (2.) Well blew out a		tor cutting 10' break	10 (00 10 (10)	
Mixed 12♯ mud w	ved in and bridged arou /LCM and tried to pump	nd bit, drill collars in. Plugged bit. Po	s and drill pipe in and Alled 60' off bottom and	le nulu
Mixed 12# mud w stuck. Perf DP (3.) Backed off at 1 Washed over and	ved in and bridged arou	ind bit, drill collars in. Plugged bit. Pu it could not break cin i 1½" tbg inside fish	s and drill pipe in and alled 60' off bottom and culation. and cleaned out to 12	le nulu nd ,225
Mixed 12# mud w stuck. Perf DP (3.) Backed off at 1 Washed over and 4-17-78. (4.) Twisted off was	ved in and bridged arou/LCM and tried to pump at 12,052 & 12,055' bu 0,680' on 3-25-78. Ran recovered 1102' of DP,	and bit, drill collars in. Plugged bit. Put could not break cir l½" tbg inside fish crossover sub and 3 jts of 7½" washpipe	and drill pipe in any alled 60' off bottom and culation. and cleaned out to 12 DC's between 4-1-78 and shoe, one $6\frac{1}{2}$ " DC,	le nulu nd ,225 nd
Mixed 12# mud w stuck. Perf DP (3.) Backed off at 1 Washed over and 4-17-78. (4.) Twisted off was 5-3/4" DC's, ju (5.) Operator will s set whipstock a	ved in and bridged arou/LCM and tried to pump at 12,052 & 12,055' bu 0,680' on 3-25-78. Ran recovered 1102' of DP, hpipe 4-17-78 leaving 6 nk basket, bit sub and et 150' cement plug abond kick off with no dir	and bit, drill collars in. Plugged bit. Put tould not break cin $1\frac{1}{2}$ " tbg inside fish crossover sub and 3 jts of $7\frac{1}{2}$ " washpipe 7-7/8" bit in hole where top of fish, let on the subject of	is and drill pipe in any alled 60' off bottom and culation. and cleaned out to 12 DC's between 4-1-78 and and shoe, one $6\frac{1}{2}$ " DC, ith top of fish at 12 dement cure, dress off	le nulu nd ,225 nd 13 ,159
Mixed 12# mud w stuck. Perf DP (3.) Backed off at 1 Washed over and 4-17-78. (4.) Twisted off was 5-3/4" DC's, ju (5.) Operator will s set whipstock a original object	ved in and bridged arou/LCM and tried to pump at 12,052 & 12,055' bu 0,680' on 3-25-78. Ran recovered 1102' of DP, hpipe 4-17-78 leaving 6 nk basket, bit sub and et 150' cement plug abond kick off with no dir	and bit, drill collars in. Plugged bit. Put could not break cing 1½" tbg inside fish crossover sub and 3 jts of 7½" washpipe 7-7/8" bit in hole we top of fish, let of the could be sectional control and	and drill pipe in any alled 60' off bottom and cleaned out to 12 DC's between 4-1-78 and shoe, one $6\frac{1}{2}$ " DC, ith top of fish at 12 then continue to dril	le nulu nd ,225 nd 13 ,159
Mixed 12# mud w stuck. Perf DP (3.) Backed off at 1 Washed over and 4-17-78. (4.) Twisted off was 5-3/4" DC's, ju (5.) Operator will s set whipstock a original object	ved in and bridged arou /LCM and tried to pump at 12,052 & 12,055' bu 0,680' on 3-25-78. Ran recovered 1102' of DP, hpipe 4-17-78 leaving 6 nk basket, bit sub and et 150' cement plug abond kick off with no dirive.	and bit, drill collars in. Plugged bit. Put could not break cing 1½" tbg inside fish crossover sub and 3 jts of 7½" washpipe 7-7/8" bit in hole we top of fish, let of the could be sectional control and	and drill pipe in any alled 60' off bottom and cleaned out to 12 DC's between 4-1-78 and shoe, one $6\frac{1}{2}$ " DC, ith top of fish at 12 then continue to dril	le nulu nd ,225 nd 13 ,159
Mixed 12# mud w stuck. Perf DP (3.) Backed off at 1 Washed over and 4-17-78. (4.) Twisted off was 5-3/4" DC's, ju (5.) Operator will s set whipstock a original object	ved in and bridged arou /LCM and tried to pump at 12,052 & 12,055' bu 0,680' on 3-25-78. Ran recovered 1102' of DP, hpipe 4-17-78 leaving 6 nk basket, bit sub and et 150' cement plug abond kick off with no dirive.	and bit, drill collars in. Plugged bit. Put could not break cing 1½" tbg inside fish crossover sub and 3 jts of 7½" washpipe 7-7/8" bit in hole we top of fish, let of the could be sectional control and	and drill pipe in any alled 60' off bottom and cleaned out to 12 DC's between 4-1-78 and shoe, one $6\frac{1}{2}$ " DC, ith top of fish at 12 then continue to dril	le nulu nd ,225 nd 13 ,159

DATE TO TOTAL

Orig. Signed by Jerry Sexton

IN THED

1.01.161378

UN COMMANDER COMM.