

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

64

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO.	30-025-26002
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	
SHOE BAR RANCH UNIT #34	
8. Well No.	1
9. Pool name or Wildcat	SHOE BAR (ATOKA)
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
39713' GR	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☐ GAS WELL ☒ OTHER	2. Name of Operator FORCENERGY GAS EXPLORATION, INC.
3. Address of Operator 2730 SW 3RD AVE. SUITE 800, MIAMI, FLORIDA 33129-2237	4. Well Location Unit Letter <u>N</u> : <u>900'</u> Feet From The <u>SOUTH</u> Line and <u>1980'</u> Feet From The <u>WEST</u> Line Section <u>34</u> Township <u>16S</u> Range <u>35E</u> NMPM LEA County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 39713' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1-17-96 SPOT 100 SX "H" NEAT CMT 11,815' - 11,700' (COULD NOT PUMP INTO - OK'D BY OCD PAUL KAUTZ)
- 1-18-96 TAG TOC 11,100' LOAD HOLE, SPOT 25 SX "H" NEAT CMT 9357' - 9256'
- 1-18-96 LOAD HOLE, SPOT 25 SX "C" NEAT CMT 6265' - 6156'
- 1-19-96 CUT & PULL 6000' 5-1/2" CSG.
- 1-22-96 LOAD HOLE W/MUD SPOT 45 SX "C" NEAT CMT 6042' - 5940' 5-1/2" STUB.
- 1-23-96 TAG TOC 5921'. LOAD HOLE W/MUD SPOT 45 SX "C" NEAT CMT 4879' - 4770' TAG TOC 4765' 9-5/8" SHOE.
- 1-24-96 LOAD HOLE W/MUD SPOT 45 SX "C" NEAT CMT 463' - 350'. TAG TOC 328' 13-3/8" SHOE.
- 1-24-96 SPOT 25 SX "C" NEAT CMT SURFACE PLUG.
- 1-26-96 REMOVE WELLHEAD, INSTALL DRY HOLE MARKER.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Larry Murray TITLE AGENT DATE 2-6-96
TYPE OR PRINT NAME LARRY MURRAY TELEPHONE NO. (915) 683-9722

(This space for State Use)

FEB 11 1997

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: