

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Santa Fe Energy Operating Partners, L.P.	8. Farm or Lease Name State NM 2
3. Address of Operator 500 W. Illinois, Suite 500, Midland, TX 79701	9. Well No. 1
4. Location of Well UNIT LETTER M 660 FEET FROM THE South LINE AND 660 FEET FROM THE West LINE, SECTION 2 TOWNSHIP 15S RANGE 32E NMPM.	10. Field and Pool, or Wildcat Sowell Morrow
15. Elevation (Show whether DF, RT, GR, etc.) 4291' - DF	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐
ALTERING CASING ☐
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 10-29-86: MIRU - notify NMOC.
10-30-86: Spot 25 sx plug on top of pkr @ 12,100'. WOC 5 hrs. Tag cmt @ 11,900'.
10-31-86: Circ hole w/mud - spot 25 sx plug @ 11,439', spot 25 sx plug @ 8995'. Spot 25 sx plug @ 7562'.
10-31-86: Cut csg @ 6180' - pulled 147 jts of 5 1/2" csg.
11-4-86: RIH w/tubing to 6240' - pump 120 bbls mud & load hole. Spot 45 sx C1 C plug @ 6240'.
11-5-86: Tag plug @ 6143' - pump mud & spot 45 sx plug @ 5451'. ~~Pump mud & spot 45 sx plug @ 5451'.~~ Pump mud & spot 75 sx plug @ 4170'.
11-6-86: Tag plug @ 4017'. Spot 35 sx plug @ 1599'. Spot 35 sx plug @ 420'. Cut off wellhead. Spot 10 sx surface plug. Install dry hole marker. Clean location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Billie Hood Billie Hood TITLE Sr. Production Clerk DATE 11-24-86
APPROVED BY [Signature] OIL & GAS INSPECTOR DATE SEP 10 1987
CONDITIONS OF APPROVAL, IF ANY: