STATE OF NEW MEXICO ENERGY AND MINERALS DEPARTMENT

DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPPRATOR	1

UIL CONSERVATION DIVISION P. O. BOX 2088

Form C-103 Revised 10-1-78

SANTA FE		—] :	SANTA FE, I	NEW	MEXICO 87501				
FILE						Γ	Sa. Indicate Type	of Lease	_
U.3.G.3.							State X	Foo	
LAND OFFICE		_					5. State Oil & Gas	Legan No.	
OPERATOR			-			1	LG 958	2	}
		لسبب					- EG 330	mm	~~
	CLIN	ODY NOTICES	AND DEPORT	SONI	VELLS	ĥ			IIII
ING MOT USE THE	5UN 707 WRU 7 C	DRY NOTICES	ON TO DECPEN OR	PLUG BA	CK TO A DIFFERENT RESERVOIR.	1			7777
	USE "APPLI	CATION FOR PERMIT	(FORM C-1017)	0x 30cx			7. Unit Agreement	Name	1
۱. هاد ا	6A8 [P&A						- 1
well	well	OTHER-					8. Farm or Lease	Name	
2. Name of Operator Yates Petrol	arm Car	rnoration					Laddie WC S	tate	
lates retion	.euii coi	.poracion					9. Well No.		
J. Address of Operator		•				1	2		- 1
•	h St.	Artesia, NM	88210				·		
4. Location of Well							10. Field and Poo		
· _		660	No	rth	660		Saunders Pe	ermo Uppe	: Per
UNIT LETTER) · · -		FROM THE	£ 611	LINE AND FE	ET FROM	TITITITI	1111111	1117
				150	2017	i			<i>[[[]]</i>
West	LIME SI	FCT10N 11	TOWNSHIP	138	RANGE 33E	имрм.			11111
THE								44444	444
mmm.	77777	1777777	Elevation (Show w	hether	DF, RT, GR, etc.)		12. County		VIII
		<i>\\\\\\</i>	4180	.5'	GR		Lea	777777	7777
Milli	777777	71111111	n m . 1:		Anna of Norice Poport	or Oth	er Data		
16.				ate N	ature of Notice, Report	OL OUI	REPORT OF:		
N	OTICE O	F INTENTION T	·o:		SUBSE	QUENI	REPORT OF:		
	•			_					
PERFORM REMEDIAL WOR			PLUG AND ABANDO	» []	REMEDIAL WORK	\sqsubseteq		ING CASING	님
					COMMENCE ORILLING OPHS.		PLUG A	NO ABANDONME	יי בא
TEMPORARILY ABANDON	H		CHANGE PLANS		CASING TEST AND CEMENT JOB	∐ .	• * -		
PULL OR ALTER CABING	لــا			_	OTHER				_ 🗀
OTHER				<u></u> []					
		to the Class	ly state all pertin	ent det	ails, and give pertinent dates, i	including	estimated date of	starting any pr	oposed
17. Describe Proposed work) SEE RULE!	or Complete 1603.	ad Obergrious (Crear	if state an period						
loors, see note									
Plugged well	l as fo	llows:			•				
Sat 5_1/2"	camant	retainer at	7675'. RIF	I w/s	tinger and tubing.	Mix	70 sx mud a	nd	
oiroulated	Stung	into retain	er. Saueez	e th	ru retainer w/200 s	acks.	Stung out	of	
circulated.	3 tung	arr coment C	n ton of re	tain	er. POOH w/tubing.	Fre	e point app	rox.	
retainer.	υ г ορ 20	SX Cement O	d sulled 1/	. 5 . 4 +	e				
5600'. Cut	casing	at 5559' an	a partea re	+J j L	01				
Spot 50 sx	plug at	5610'. Tag	ged plug at	. 544	•				
Spot 50 sx	plug at	4238'. Tag	ged plug at	401	т.				
Spot 35 sx	plug fr	om 1632-1532	2'•						
Spot 15 sx	plug fr	om 30° to su	rface.						
Heavy mud b									
Classed 1sa	ation	Installed d	lry hole man	rker.					
Cleaned 10c	allUll.	1115 CALLEU V	ity note man						
Plugging co	mpreted	1-10-8/.							
			•						

i8. I-hereby certify that the information above is true and comple	Production Supervisor	DATE	1-23-87
Tule F. Turnaclill	DIL & GAS INSPECTOR	DATE	DEC 3 0 1988
CONDITIONS OF APPROVAL. IF ANY:			