

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
LG 958

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Name of Operator Yates Petroleum Corporation Address of Operator 207 South 4th St., Artesia, NM 88210 Location of Well UNIT LETTER D, 660 FEET FROM THE North LINE AND 660 FEET FROM The West LINE, SECTION 11, TOWNSHIP 15S, RANGE 33E, NMPM. 15. Elevation (Show whether DF, RT, GR, etc.) 4180.5' GR	7. Unit Agreement Name 8. Farm or Lease Name Laddie WC State 9. Well No. 2 10. Field and Pool, or Whilcat Saunders Permo Upper Per 12. County Lea
---	---

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER Perforate & Treat <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

FD 10245'. WIH and perforated 9996-10031' w/19 .45" holes as follows: 9996, 98, 10000, 02, 03, 04, 05, 06, 07, 14, 15, 16, 17, 18, 20, 21, 28, 30 and 10031'. RIH w/tubing and packer. Set packer at 9937'. Acidized perforations 9996-10031' w/5000 gals 15% NE acid and ball sealers. Show of oil. POOH w/packer. WIH and perforated 9896-9973' w/18 .45" holes as follows: 9896, 97, 98, 9905, 06, 07, 08, 19, 20, 21, 28, 30, 31, 64, 65, 71, 72, 73'. RIH w/packer and RBP. Treated perforations 9896-9973' w/4500 gallons 15% NE acid and 15 ball sealers. POOH w/packer and RBP. Set pumping equipment. Begin pumping back load.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed Jerry Sexton TITLE Production Supervisor DATE 6-9-83

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT SUPERVISOR

APPROVED BY _____ TITLE _____ DATE JUN 15 1983

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
JUN 13 1983
O.C.D.
HOBBS OFFICE