

COPIES RECEIVED		
DISTRIBUTION		
NTA FE		
LE		
S.G.S.		
ND OFFICE		
PERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

30-025-28606

5a. Indicate Type of Lease

State ☒ Fee ☐

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

Name of Operator

Maralo, Inc.

Address of Operator

P.O. Box 832, Midland, Tx 79702-0832

Location of Well

UNIT LETTER 0 660 South 2310
FEET FROM THE LINE AND FEET FROM
East LINE, SECTION 10 TOWNSHIP 15-S RANGE 33-E NMPM.

7. Unit Agreement Name

8. Farm or Lease Name

State "10"

9. Well No.

1

10. Field and Pool, or Wildcat
Saunders (Bench "C")

Perms upper Perm

11. Elevation (Show whether DF, RT, GR, etc.)

4179.5 GR

12. County
Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

FORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
CLOG OR ALTER CASING ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work.) SEC RULE 1103.

1. Notify NMOCC prior to operations.
2. RUPU. TOH w/pumping equipment.
3. RU wireline. TIH w/5 1/2" CIBP and set @ ±9800'. Cap w/35' cmt (5 sx).
4. TIH w/tbg open ended to PBTD and load the hole w/9.5#/gal mud-laden fluid.
5. Spot 100' plug (25 sx) from 8950-9050' (across DV tool).
6. Spot 100' plug (25 sx) from 5750-5850' (across Glorieta).
7. RU csg cutters and cut csg @ ± 4,000'. Pull and lay down csg.
8. TIH w/tbg. Spot 100' plug (30 sx) from 3950' to 4050' (across csg stub).
9. Spot 100' plug (35 sx) from 1500' to 1600' (across Rustler).
10. Spot 100' plug (35 sx) from 350' to 450'.
11. Spot 10' plug (5 sx) at surface.
12. Cut off wellhead, weld on P&A plate, and clean up location.

hereby certify that the information above is true and complete to the best of my knowledge and belief.

Brenda Coffman

TITLE Agent

DATE 6-28-90

ORIGINAL SIGNED BY JERRY SEXTON
SUPERVISOR

SIGNED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: