Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT Holds IN SEAD OIL CONSERVATION DIVISION P.O. Box 1989. P.O. Box 1989. P.O. Box 1989. B. Santa Fe, New Mexico 87504-2088 DISTRICT B. COMMENT OF PROPOSALS TO DRILL OR TO DESPEN OR PLUG BACK TO A STATE STATE FEE STATE F	District Office					-	
Same Age	DISTRICT I P.O. Box 1980, Hobbs, NM 88240						
S. Indicate type of Lates STATE FEE	DISTRICT II Santa Fe. New Mexico 87504-2088						
South Of A College South	P.O. Drawer DD, Artesia, NM 88210				pe of Lease STATE FEE		
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSCALS) 1. Type of Will: (SCALL				i			
CDO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOR. US: *PULCATION FOR PENINT' (FORM C-101) FOR SUCH PROPOSALS.) Type of Well:	SUNDRY NOTICE	ES AND REPORTS ON WEL	LS		<i>"""""""""</i>		
CNAIL X	(DO NOT USE THIS FORM FOR PROP DIFFERENT RESERVE (FORM C-10	OSALS TO DRILL OR TO DEEPEN O	OR PLUG BACK TO A	7. Lease Name or Uni	it Agreement Name		
2 Name of Operator 105 South 4th St., Artesia, NM 88210 3 Address of Operator 105 South 4th St., Artesia, NM 88210 4 Will Located Unit Letter L : 1980 Feet From The South Line and 660 Feet From The West Line Section 27 Township 16S Range 35E NMPM Lea County 10. Elevation (Show whether DF, RKB, RT, GK, atc.) 3991. 'GR 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMOVED ALTER CASING COMMENCE DRILLING OPNS. PLUG AND ABANDON CHANGE PLANS 12. Describe Proposed or Completed Operations (Clearly store all peritoent details, and give peritoent data; including estimated data of storting any proposed world SEE RULE 1103. 1-13-98 - Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" 32# and 11" 5000# starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in and rigged up pulling unit (Sierra Well Service). Nippled up 11" 1-900 - Heaving Serve pit. 1-80 tubing. Tagged up at 1552'. Rigged up swivel. Spudded in at 12:00 noon 1-16-98. Fell out of cement plug at 1670'. Till and tagged up at 1930'. Fell out at 1950'. Till and tagged up at 5773'. Washed down to 5836'. Drilled to 6030'. Fell out of plug. Till and tagged up at 8655'. Drilled to 9628'. 1 heavy cutry this fee information above is fits and complete to the best of my transverded and tested. 1 heavy cutry this fee information above is fits and complete to the best of my transverded and best of the Starting and Starting Technician 1 THE HORNEN TRANS THE PORT OF THE HORN	OR	OTHER		Medusa	ASG State		
3. Address of Operation 105 South 4th St., Artesia, NM 88210 4. Well Location Usis Letter L : 1980 Feet From The South Line and 660 Feet From The West Line Section 27 Township 16S Range 35E NMFM Lea County 10. Elevation (Show whether DP, RKB, RT, GR, etc.) 3991' GR 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: REMEDIAL WORK ALTERING CASING CHANGE PLANS CASING TEST AND CEMENT JOB COTHER: COMMENCE DRILLING OPNS. PLUG AND ABANDON CASING TEST AND CEMENT JOB COTHER: DOTHER: Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" casing. 1-14-98 - Weld on piece of 8-5/8" 32# and 11" 5000# Starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in and rigged up pulling unit (Sierra Well Service). Nippled up 11" 5000# spool and BOP. Tested BOP to 5000#. Nippled up flowlines to tanks. Shut down. 1-17-98 - TIH with 7-7-8" millstoch center bore bit. 12 4-3/4" drill collar on 2-7/8". Fell out of cement plug at 1670'. TiH and tagged up at 1930'. Fell out at 1950'. Fell out at 1950'. TiH and tagged up at 8655'. Drilled to 9628'. The Operations Technician DATE DATE OF THE TIME TECHNICAL SECURATIONS. The Operations Technician DATE DATE OF THE TIME TECHNICAL SECURATIONS. THE OPERATIONS. DOTATION THE TIME DEPORTS OF THE TIME OPERATIONS OF THE TIME TECHNICAL SECURATIONS. THE OPERATIONS. DOTATION THE TIME OPERATIONS. THE OPERATIONS. DOTATION THE TIME OPERATIONS. THE OPERATIONS. DOTATION THE TIME OPERATIONS. THE OPERATION THE TIME OPERATIONS. THE OPERATION TO SUPPLEMENTS.	2. Name of Operator	TON		· 			
1.0 South 4th St., Artesia, NM 88210 4. Well Lossidos Unit Letter L : 1980 Feet From The South Line and 660 Feet From The West Line Socios 27 Township 168 Range 35E NMFM Lea County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3991' GR 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON GRANDON		LUN		9 Pool name or Wild	1		
Well Location Unit Letter L 1980 Feed Proon The South Line and 660 Feed Froon The West Line							
Section 27 Township 16S Range 35E NMPM Lea County 10. Elevation (Show whathar Dip, RRB, RT, GR, etc.) 3991' GR				NIII WILLIAM			
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3991' GR 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS SUBSEQUENT REPORT OF: REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT OTHER: 12. Describe Proposed or Completed Operations (Clearly state all periosen details, and give periosen dates, including estimated date of starting any proposed word). Size RULE 1103. 1-13-98 - Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" casing. 1-14-98 - Weld on piece of 8-5/8" 32# and 11" 5000# starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in and rigged up pulling unit (Sierra Well Service). Nippled up 11" 5000# spool and BOP. Tested BOP to 5000#. Nippled up flowlines to tanks. Shut down. 1-17-98 - TIH with 7-7/8" milltooth context by survel. Spudded in at 12:00 noon 1-16-98. Fell out of cement plug at 1670'. TIH and tagged up at 1552'. Rigged up swivel. Spudded in at 12:00 noon 1-16-98. Fell out of plug at 4540'. Circulate hole clean. Tested casing to 500#. TIH and tagged up at 5773'. Washed down to 5836'. Drilled to 6030'. Fell out of plug. TIH and tagged up at 8655'. Drilled to 9628'. 1 Intrody certify the 16 information accepts for the best of my towindge and bedief. 1 THE OPERATIONAL RUSHER WILLIAMS OPERITANCE TESTER BOX COMMENTS OF THE SWILLIAMS OPERITANCE TESTER BOX COMMENTS OF THE SWILLIAMS DESTRICT I SUPERVISION	Unit Letter L : 1980	Feet From The South	Line and660	Feet From Th	West	Line	
10. Elevation (Show whither DF, RKB, RT, GR, etc.) 3991' GR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS SUBSEQUENT REPORT OF: REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: TO THER: Spud - re-entry To The Spud - re-ent	Section 27	Townshin 16S Ray	10e 35E	NMPM Le	ea	County	
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE ORILLING OPNS. PLUG AND ABANDON METER CASING OTHER: DOTHER:				······································	///////////////////////////////////////		
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT THE COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT THE Spud - re-entry TEMPORARILY ABANDON THER. Spud - re-entry TEMPORARILY SEE RULE 1103. 1-13-98 - Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" casing. 1-14-98 - Weld on plece of 8-5/8" 32# and 11" 5000# starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in and rigged up pulling unit (Sierra Well Service). Nippled up 11" 5000# spool and BOP. Tested BOP to 5000#. Nippled up flowlines to tanks. Shut down. 1-17-98 - TIH with 7-7/8" milltooth center bore bit, 12 4-3/4" drill collars on 2-7/8" L-80 tubing. Tagged up at 1552'. Rigged up swivel. Spudded in at 12:00 noon 1-16-98. Fell out of cement plug at 1670'. TIH and tagged up at 1930'. Fell out at 1950'. TIH to 4350'. Fell out of plug at 4540'. Circulate hole clean. Tested casing to 500#. TIH and tagged up at 5773'. Washed down to 5836'. Drilled to 6030'. Fell out of plug. TIH and tagged up at 8655'. Drilled to 9628'. (Phis space for State Use) ORIGINAL SIGNED BY CHRIS WILLIAMS ORIGINAL SIGNED BY CHRIS WILLIAMS ORIGINAL SIGNED BY CHRIS WILLIAMS		77777					
PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT OTHER: 12 Describe Proposed or Completed Operations (Clearly state all periment details, and give periment dates, including estimated date of starting any proposed work) SEE RULE 1103. 1-13-98 — Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" 32# and 11" 5000# starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 — Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 — Moved in re-entry equipment (Star Tool). Set tanks. Shit down. 1-17-98 — TIH with 7-7/8" milltooth center bore bit, 12 4-3/4" drill collars on 2-7/8" L-80 tubing. Tagged up at 1552'. Rigged up swivel. Spudded in at 12:00 noon 1-16-98. Fell out of cement plug at 1670'. TIH and tagged up at 1930'. Fell out at 1950'. TIH to 4350'. Fell out of plug at 4540'. Circulate hole clean. Tested casing to 500#. TIH and tagged up at 8655'. Drilled to 9628'. Thereby certify the information above is the and complete to the best of my browindge and belief. SHONATURE STARD CEMENT SHOPENNISOD STARDET IS HEREBY STARDET	-	' • • • • · · · · · · · · · · · · · · ·					
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT DEPULLOR ALTER CASING CASING TEST AND CEMENT JOB DITHER: 12 Describe Proposed or Completed Operations (Clearly state all perinent details, and give perinent datas, including estimated date of starting any proposed world SEE RULE 1103. 1-13-98 - Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" casing. 1-14-98 - Weld on piece of 8-5/8" 32# and 11" 5000# starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in and rigged up pulling unit (Sierra Well Service). Nippled up 11" 5000# spool and BOP. Tested BOP to 5000#. Nippled up flowlines to tanks. Shut down. 1-17-98 - TIH with 7-7/8" milltooth center bore bit, 12 4-3/4" drill collars on 2-7/8" L-80 tubing. Tagged up at 1552'. Rigged up swivel. Spudded in at 12:00 noon 1-16-98. Fell out of cement plug at 1670'. TIH and tagged up at 1930'. Fell out at 1950'. TIH to 4350'. Fell out of plug at 4540'. Circulate hole clean. Tested casing to 500#. TIH and tagged up at 8655'. Drilled to 9628'. Thereby certify the las information above is the and complete to the best of my knowledge and belief. SIONATURE TITLE OFFIRM NAME TITLE OPERATIONAME CHOIS SUBSENIE. SIONED BY CHRIS WILLIAMS DISTRICT IS HEPERVISOR	NOTICE OF INTE	INTION TO:	SUB	SEQUENT REI	PORT OF:		
CASING TEST AND CEMENT JOB OTHER: OTHER: Spud - re-entry OTHER: Spud - re-entry II 12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 1-13-98 - Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" 32# and 11" 5000# starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in and rigged up pulling unit (Sierra Well Service). Nippled up 11" 5000# spool and BOP. Tested BOP to 5000#. Nippled up flowlines to tanks. Shut down. 1-17-98 - TIH with 7-7/8" milltooth center bore bit, 12 4-3/4" drill collars on 2-7/8" L-80 tubing. Tagged up at 1552'. Rigged up swivel. Spudded in at 12:00 noon 1-16-98. Fell out of cement plug at 1670'. TIH and tagged up at 1930'. Fell out at 1950'. TIH to 4350'. Fell out of plug at 4540'. Circulate hole clean. Tested casing to 500#. TIH and tagged up at 8655'. Drilled to 9628'. Ihereby certify that the information above is toge and complete to the best of my knowledge and belief. SIGNATURE TITLE OPERATIONAME RUSTY Klein TITLE OPERATIONAME RUSTY Klein TITLE OPERATIONAME SUCCESSIONAME SUCCE	PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	AL	TERING CASING		
CASING TEST AND CEMENT JOB OTHER: OTHER: Spud - re-entry OTHER: Spud - re-e	TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	G OPNS. PL	UG AND ABANDOI	MENT	
12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 1-13-98 - Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" casing. 1-14-98 - Weld on piece of 8-5/8" 32# and 11" 5000# starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in and rigged up pulling unit (Sierra Well Service). Nippled up 11" 5000# spool and BOP. Tested BOP to 5000#. Nippled up flowlines to tanks. Shut down. 1-17-98 - TIH with 7-7/8" milltooth center bore bit, 12 4-3/4" drill collars on 2-7/8" L-80 tubing. Tagged up at 1552'. Rigged up swivel. Spudded in at 12:00 noon 1-16-98. Fell out of cement plug at 1670'. TIH and tagged up at 1930'. Fell out at 1950'. TIH to 4350'. Fell out of plug at 4540'. Circulate hole clean. Tested casing to 500#. TIH and tagged up at 8655'. Drilled to 9628'. Ihereby certify that the information aboye is fore and complete to the best of my knowledge and belief. SIONATURE THE PROPERTY LAMBER RUSTY Klein THE OPERATOR SET STATES WILLIAMS OPERATOR STATES WILLIAMS DISTRICT I SUPPRISSOR			•				
Work) SEE RULE 1103. 1-13-98 - Dug out cellar. Removed dry hole marker. 13-3/8" casing capped off with plate. Cut 13-3/8" casing. Dressed off 8-5/8" casing. 1-14-98 - Weld on piece of 8-5/8" 32# and 11" 5000# starting head. Backfilled cellar. Cleaned location and dug reserve pit. 1-15-98 - Moved in re-entry equipment (Star Tool). Set tanks. Set and tested anchors. 1-16-98 - Moved in and rigged up pulling unit (Sierra Well Service). Nippled up 11" 5000# spool and BOP. Tested BOP to 5000#. Nippled up flowlines to tanks. Shut down. 1-17-98 - TIH with 7-7/8" milltooth center bore bit, 12 4-3/4" drill collars on 2-7/8" L-80 tubing. Tagged up at 1552'. Rigged up swivel. Spudded in at 12:00 noon 1-16-98. Fell out of cement plug at 1670'. TIH and tagged up at 1930'. Fell out at 1950'. TIH to 4350'. Fell out of plug at 4540'. Circulate hole clean. Tested casing to 500#. TIH and tagged up at 5773'. Washed down to 5836'. Drilled to 6030'. Fell out of plug. TIH and tagged up at 8655'. Drilled to 9628'. Ihereby certify that the information above is the and complete to the best of my knowledge and belief. SIONATURE TIME Operations Technician DATE Jan. 19, 1998 THE Jan. 19, 1998 THE PHONE NO. 505/748-14 THE PHONE NO. 505/748-14	OTHER: OTHER: Spud - re-			re-entry		X	
(This space for State Use) ORIGINAL SIGNED BY CHRIS WILLIAMS DISTRICT L SUPERVISOR	work) SEE RULE 1103. 1-13-98 - Dug out cell. Cut 13-3/8" casing. D 1-14-98 - Weld on piec Cleaned location and d 1-15-98 - Moved in re- 1-16-98 - Moved in and 5000# spool and BOP. 1-17-98 - TIH with 7-7 L-80 tubing. Tagged u Fell out of cement plu TIH to 4350'. Fell ou 500#. TIH and tagged of plug. TIH and tagg	ar. Removed dry hole ressed off 8-5/8" cas e of 8-5/8" 32# and 1 ug reserve pit. entry equipment (Star rigged up pulling un Tested BOP to 5000#./8" milltooth center p at 1552'. Rigged ug at 1670'. TIH and t of plug at 4540'. up at 5773'. Washed ed up at 8655'. Dril	marker. 13-3/ing. 1" 5000# starti Tool). Set ta it (Sierra Well Nippled up flo bore bit, 12 4- p swivel. Spuc tagged up at 19 Circulate hole down to 5836'. led to 9628'.	/8" casing cap ing head. Bac anks. Set and l Service). N owlines to tan -3/4" drill co dded in at 12: 930'. Fell ou clean. Teste Drilled to 6	ped off with kfilled cell tested anch ippled up 11 ks. Shut do 11 ars on 2-7 00 noon 1-16 at 1950'. d casing to 030'. Fell	own. 7/8" 5-98.	
(This space for State Use) ORIGINAL SIGNED BY CHRIS WILLIAMS DISTRICT L SUPERVISOR	Rusty Klein	<u></u> IIII					
ORIĞINAL SIGNED BY CHRIS WILLIAMS DISTRICT I SIPERVISOR	TYPE OR PRINT NAME						
DISTRICT I SUPERVISOR		/ OUDIO 1411			្ស ប្	1003	
	DISTRICT LS	CHRIS WILLIAMS				1270	

CONDITIONS OF APPROVAL, IF ANY: