

AVANTI ENERGY CORPORATION
DICKINSON CATTLE CO. NO. 1-17
LEA COUNTY, NEW MEXICO
DETAILED PLUGGING PROCEDURE
PAGE -3-

32. Pull up hole to clear cement.
33. Mix 110 barrels mud and pump to spot (110 barrels 10# brine with 27 sacks salt water gel).
34. Pull out of hole with tubing, lay down 44 joints tubing, stand balance in derrick.
35. Place bottom of tubing at 4950' K.B.
36. Circulate 65 sack plug to spot (estimated top at 4800' K.B.).
37. Pick-up from cement.
38. Mix 170 barrels mud and pump to spot (170 barrels 10# brine with 42 sacks salt water gel).
39. Pull out of hole with tubing, lay down 87 joints tubing, stand balance in derrick.
40. Place bottom of tubing at 2200' K.B.
41. Circulate 40 sack plug to spot (estimated top at 2084' K.B.).
42. Mix 130 barrels mud and pump to spot (130 barrels 10# brine with 35 sacks salt water gel).
43. Pull out of hole with tubing, lay down 56 joints tubing, stand balance in derrick.
44. Place bottom of tubing at 430' K.B.
45. Circulate 40 sack plug to spot (estimated top at 315' K.B.).
46. Pull out of hole with tubing; lay all tubing down except one stand.
47. Go in hole with one stand tubing to 30'+ K.B.
48. Fill hole with cement (use 10 sacks).
49. Remove 8-5/8" head.
50. Cut off 13-3/8" head.