

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-28761
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG-6345
7. Lease Name or Unit Agreement Name Brown State Unit
8. Well No. 28-1
9. Pool name or Wildcat Anderson Ranch Wolfcamp, N.
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator Synergy Oil & Gas, Inc.
3. Address of Operator 9821 Katy Freeway, Suite 800; Houston, Texas 77024	4. Well Location Unit Letter <u>b</u> : <u>660</u> Feet From The <u>North</u> Line and <u>1980</u> Feet From The <u>East</u> Line Section <u>28</u> Township <u>15-S</u> Range <u>32-E</u> NMPM <u>Lea</u> County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-25-97 Notified OCD. MIRU. Pulled rods.

6-26-97 Contacted Jack Griffin. POOH w/ tbg. Set 5-1/2" CIBP @ 9800'. Circulated hole w/ mud from 9800' and pumped 25 sx H cmt 9800-9548'. Pumped 25 sx C cmt 6970-6700'.

6-27-97 Contacted Jack Griffin. Pumped 25 sx C cmt 5746-5494'. Pumped 25 sx C cmt 4176-3924'.

6-30-97 Contacted Jack Griffin. CBL showed csg free @ 1960'. Tagged plug @ 3910' and cut 5-1/2" csg @ 1940', csg not free. Recut csg @ 1940', started out of hole w/ csg.

7-01-97 POOH w/ 5-1/2" csg. Loaded hole w/ mud and pumped 50 sx C cmt w/ 2% CaCl₂ @ 2009'. WOC and tagged @ 1789'. Pumped 50 sx C cmt 471-250'. Tagged plug @ 250'. POOH and pumped 10 sx C cmt 40'-surf.

7-02-97 Cut off wellhead & capped well. Covered pit and dug up dead men. Installed dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE W.D. Burch TITLE VP-Operations DATE 7-15-97

TYPE OR PRINT NAME W.D. Burch TELEPHONE NO. 713 461-6626

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE AUG 29 1997

CONDITIONS OF APPROVAL, IF ANY:

W.D.

CP