

Submit 3 Copies To Appropriate District

Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

811 South First, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
2040 South Pacheco  
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. <b>30-025-29132</b>
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator <b>TMBR/Sharp Drilling, Inc.</b>		6. State Oil & Gas Lease No. <b>A-1320</b>
3. Address of Operator <b>P.O. Drawer 10970, Midland, Texas 79702</b>		7. Lease Name or Unit Agreement Name:  <b>New Mexico - EQ-State</b>
4. Well Location Unit Letter <b>J</b> : <b>1980</b> feet from the <b>S</b> line and <b>1980</b> feet from the <b>E</b> line Section <b>16</b> Township <b>16S</b> Range <b>35E</b> NMPM <b>Lea</b> County		8. Well No. <b>1</b>
10. Elevation (Show whether DR, RKB, RT, GR, etc.) <b>4003' GR</b>		9. Pool name or Wildcat <b>Shoebar, Strawn Northwest</b>

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

4/28/00 Notified OCD, Johnny Robinson. MIRU plugging equipment. Loaded hole w/ 260 bbls 10# plugging mud. Set CIBP @ 11,100' as per Johnny Robinson w/ OCD. Dumpbailed 35' cmt on top of CIBP @ 11,100 - 11,065'.

5/1/00 Cut casing @ 9,838'. Casing not free. PU packer, pressured up on casing to 1,500 psi, no rate thru cut.

5/2/00 Notified OCD, Johnny Robinson. Cut csg @ 8,294'. Established circulation in 5-1/2 x 9-5/8" annulus thru cut.

5/3/00 Pumped 25 sx C cmt 9,891 - 9,637'. Start out of hole w/ 5-1/2" csg. SDFN.

5/4/00 Notified OCD, Johnny Robinson. Finished POOH w/ 5-1/2" csg. Pumped 60 sx C cmt @ 8,355'. WOC and tagged plug @ 8,135'. Pumped 35 sx C cmt 7,537 - 7,427'. Pumped 50 sx C cmt @ 5,064'.

5/5/00 OCD, Billy Prichard on location. Tagged plug @ 4,914'. Pumped 40 sx C cmt 2,188 - 2,066'. Pumped 45 sx C cmt @ 569'. WOC and tagged plug @ 439'. Pumped 20 sx C cmt 60' to surface.

5/11/00 Cut off wellhead and installed marker, cut off anchors, leveled pit and cellar.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jeffrey D. Phillips TITLE **Vice President** DATE **6/5/00**

Type or print name Jeffrey D. Phillips Telephone No. **915-699-5050**  
(This space for State use)

APPROVED BY Johnny Robinson TITLE **OIL & GAS INSPECTOR** DATE 6/5/00  
Conditions of approval, if any:

GWW

