

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Aracaja, NM 88210

DISTRICT III
1000 Rio Arriba Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-29174
5. Indicate Type of Lease	STATE ☒ FEZ ☐
6. State Oil & Gas Lease No.	

7. Lease Name or Unit Agreement Name	Lea "CS" State (NCT-A)
8. Well No.	1
9. Pool name or Wildcat	Anderson Ranch Wolfcamp

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator Chevron U.S.A. Inc.	
3. Address of Operator P.O. Box 670, Hobbs, NM 88240	
4. Well Location Unit Letter <u>B</u> : <u>660</u> Feet From The <u>North</u> Line and <u>1650</u> Feet From The <u>East</u> Line Section <u>10</u> Township <u>16S</u> Range <u>32E</u> NMPM Lea County	
10. Elevation (Show whether OF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
- 1) NOTIFY OCD @ 393-6161 24 HRS PRIOR TO START OF P&A OPERATIONS
 - 2) TIH W/ WORKSTRING TO PBTD @ 9595' ± CIRC WELLBORE W/P&A MUD
 - 3) SET 200' BALANCED CMT PLUG F 9000 TO 8800 W/25 SXS CMT TO COVER TOP OF WOLFCAMP @ 8942'
 - 4) SET 200' BALANCED CMT PLUG F 7000 TO 6800 W/25 SXS CMT TO COVER TOP OF ABO @ 7638', TOP OF DRINKARD @ 7094 & TOP OF TUBB @ 6863'
 - 5) FREE POINT & CUT 5 1/2" CSG AS DEEP AS POSSIBLE TSITOC@ 6800'. PULL & RECOVER 5 1/2" CSG INSTALL THREAD PROTECTORS.
 - 6) SET 100' BALANCED CMT PLUG ACROSS TOP OF 5 1/2" CSG STUB(50' BELOW & 50' ABOVE) W/30 SXS
 - 7) SET 100' BALANCED CMT PLUG 5700 TO 5500 W/30 SXS TO COVER TOP OF GLORIETA @ 5643'
 - 8) SET 100' BALANCED CMT PLUG F 3050 TO 2950 W/30 SXS TO COVER 8 5/8" CSG SHOE
 - 9) SET 100' BALANCED CMT PLUG F 450 TO 350 W/30 SXS TO COVER BASE FRESH WATER
 - 10) SET 10 SXS SURFACE PLUG
 - 11) CUT OFF WH INSTALL DRYHOLE MARKER
 - 12) CHANGE WELLBORE STATUS TO PLUGGED & ABANDONED

**P&A MUD WILL BE PLACED BETWEEN
ALL CMT PLUGS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE M. E. Akins 4/26/90

TITLE Staff Drlg. Engr.

DATE 6-25-90

TYPE OR PRINT NAME M. E. Akins

TELEPHONE NO. 393-4121

(This space for State Use)
ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____

CONDITIONS OF APPROVAL, IF ANY:

JUN 27 1990

RECEIVED

JUN 26 1990

OCD
HOOLES OFFICE