

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.

30-025-29306

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

E-2116-2

7. Lease Name or Unit Agreement Name

State "F"

8. Well No.

5

9. Pool name or Wildcat

Saunders Permo Upper Penn

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☒

GAS
WELL ☐

OTHER

2. Name of Operator

Charles B. Gillespie, Jr.

3. Address of Operator

P.O. Box 8, Midland, Texas 79702

4. Well Location

Unit Letter L : 1980 Feet From The South Line and 400 Feet From The West Line

Section 2

Township 15-S

Range 33-E

NMPM

Lea

County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4200 KB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

** 5-1/2" casing collapsed in well at 5086'. Shot 2-3/8" tbg off at 5240'. Pulled remainder of tubing. Swedged on casing 4 days. Could not get swedge back inside 5-1/2" casing. Received verbal approval from Jerry Sexton on 7/17/96 to squeeze off casing at 5086 and P & A well. On 7/18/96 well was squeezed with 500 sacks of class "C" with 2% CaCl₂ and 200 sacks of Class "C" Neat. On 7/19/96 the top of cement inside 5-1/2" casing was tagged at 4658'. Pressured up on Bradenhead and 5-1/2" casing to 500# for 10 min. Held OK.

Propose to plug well as follows:

1. Load hole w/mud.
2. Cut and pull 5-1/2" casing at 8-5/8" shoe at 4254'.
3. Spot 30 sacks plug at 5-1/2" stub and 8-5/8" shoe. Tag.
4. Spot 25 sacks plug at 13-3/8" shoe at 335'.
5. 15 sacks plug at surface.
6. Weld on 4" surface marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Kevin Widner

TITLE

Production Manager

DATE 7-30-96

TYPE OR PRINT NAME

Kevin Widner

TELEPHONE NO (915) 683-1765

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY

TITLE

DATE

SEP 09 1996

CONDITIONS OF APPROVAL, IF ANY: