

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. LG 3562

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <u>P&amp;A</u>	7. Unit Agreement Name
2. Name of Operator Yates Petroleum Corporation	8. Farm or Lease Name Vacuum North ADJ State
3. Address of Operator 105 South 4th St., Artesia, NM 88210	9. Well No. 1
4. Location of Well UNIT LETTER <u>D</u> <u>833</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>34</u> TOWNSHIP <u>16S</u> RANGE <u>34E</u> NMPM.	10. Field and Pool, or Wildcat S. Upper Kemnitz Wolfcamp <u>Kemnitz Lower Wolfcamp</u>
15. Elevation (Show whether DF, RT, GR, etc.) 4008.5' GR	12. County Lea

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐  
OTHER ☐

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER ☐  
ALTERING CASING ☐  
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged well as follows: Pull RBP out of hole @10917'.  
Circulated hole with 10#/gal salt gel.  
Set plugs as follows:  
12882' w/35 sx cement. Tagged plug at 12621'.  
12407' w/35 sx cement. Tubing stuck in plug, back off at 11319'.  
10207' w/35 sx cement. Tagged plug at 9859'.  
Set CIBP at 8070' w/35' cement on top.  
Set CIBP at 6050' w/35' cement on top.  
Cut 5½" casing at 4700' and pull. (Ran free point, casing free at 4803', stuck at 5006'.)  
4802' w/75 sx cement plug. Tagged plug at 4438'.  
1697' w/35 sx cement plug.  
40'-surface w/25 sx cement plug. to 1563'.

Set regulation abandonment marker. Completed plugging 10-29-86.  
Verbal permission for plugging given by Mr. Eddie Seay, NMOCD, Hobbs, 10-20-86, to Mr. Ray Stall, YPC.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature]

TITLE Production Supervisor

DATE 10-30-86

APPROVED BY [Signature]

TITLE OIL & GAS INSPECTOR

DATE DEC 19 1986

CONDITIONS OF APPROVAL, IF ANY:

30-085  
20500  
E