

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-31110
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V-1682
7. Lease Name or Unit Agreement Name Red Hat State Unit
8. Well No. 1
9. Pool name or Wildcat East Anderson Ranch Penn

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> Recompletion	
2. Name of Operator YATES PETROLEUM CORPORATION	
3. Address of Operator 105 South 4th St., Artesia, NM 88210	
4. Well Location Unit Letter 0 : 3300 Feet From The South Line and 1980 Feet From The East Line Section 2 Township 16S Range 33E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4192' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: Perforate, Treat <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

POOH with rods and pump. ND wellhead and NU BOP. Unset tubing anchor and tally out of hole. TIH w/5½" Uni V packer and retrieving tool. TIH with RBP, set at 10200'. Spot 1000 gals at 9875'. TOOH with RBP. Perforated 9849, 50, 51 and 9859-70' w/15 - .50" holes (1 SPF). Acidized perfs 9849-70' w/1500 gals 15% NEFE acid. Swabbed with no shows. TIH w/RBP and set at 9560', tested to 2000#, OK. Spot 2 bbls 20% NEFE acid across perfs. TOH w/tubing. Perforated 5808-18' w/22 - .50" holes (2 SPF). POH with casing guns. TIH w/packer and set at 5713'. Pumped 1000 gals 20% NEFE acid + 30 ball sealers. Recovered load and swabbed with no shows.

Above work began 10-10-91 thru 10-21-91.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE 10-23-91  
TYPE OR PRINT NAME Juanita Goodlett TELEPHONE NO. 505/748-1471

(This space for State Use)

ORIGINAL SIGNED BY SUPERVISOR  
DISTRICT I SUPERVISOR

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: