

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-31606 ✓
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V-3211
7. Lease Name or Unit Agreement Name Scratchy Ranch State Unit
8. Well No. 2
9. Pool name or Wildcat East Leather Wildcat Upper Penn

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator YATES PETROLEUM CORPORATION	3. Address of Operator 105 South 4th St., Artesia, NM 88210	4. Well Location Unit Letter <u>P</u> : <u>660</u> Feet From The <u>South</u> Line and <u>660</u> Feet From The <u>East</u> Line
---	--	--	---

Section <u>14</u>	Township <u>15S</u>	Range <u>32E</u>	NMPM	Lea	County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4255' GR					

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
<b>NOTICE OF INTENTION TO:</b>		<b>SUBSEQUENT REPORT OF:</b>	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <u>Perforations</u> <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Cleaned location and set anchors. Installed tubinghead. TIH w/bit, stabilizer, drill collars and tubing. Drilled DV tool. Tested to 1500#. TOOH. TIH w/bit and scraper to DV tool. Tagged PBDT at 10940'. Displaced hole with 2% KCL water. TOOH. Logged. TIH w/Uni V packer to 10650'. Spotted 5 bbls 15% HCL acid at 10650'. Pulled packer to 10504'. Reversed 5 bbls. Nippled down BOP. Nippled up tree. Set packer and tested casing to 1000#. TIH and perforated 10627-10633' w/13 .42" holes (2 SPF). TOOH. Pumped 10 bbls acid. Opened bypass. Spotted 8 bbls 15% HCL acid. Closed bypass.

Turned to production.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE June 7, 1993

TYPE OR PRINT NAME Juanita Goodlett TELEPHONE NO. 505/748-1471

(This space for State Use) ORIGINAL SIGNED BY JERRY SEXTON  
DISTRICT I SUPERVISOR

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE JUN - 9 1993

CONDITIONS OF APPROVAL, IF ANY:

JUN 0 8 1993

OCD HOBBS OFFICE