

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-31673
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	V-3273
7. Lease Name or Unit Agreement Name	Eidson Ranch Unit
8. Well No.	4
9. Pool name or Wildcat	Arab-C San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator YATES PETROLEUM CORPORATION
3. Address of Operator 105 South Fourth Street - Artesia, NM 88210	4. Well Location Unit Letter <u>R</u> : <u>1980</u> Feet From The <u>South</u> Line and <u>1650</u> Feet From The <u>East</u> Line Section <u>5</u> Township <u>16S</u> Range <u>33E</u> NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4421' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8-15-94 - Moved in and rigged up pulling unit. Nippled down wellhead and nipped up BOP. POOH with tubing and seating nipple. Rigged up wireline. Picked up 7" CIBP. RIH and tagged up at 4272'. POOH and laid down 7" CIBP. Rigged down wireline. RIH w/40 joints of 2-7/8" tubing. Shut down for night. NOTE: Notified Gary Wink w/OCD in Hobbs of commencing operations.

8-16-94 - POOH with 2-7/8" tubing. Picked up bit. RIH w/tubing to 5600'. POOH with 2-7/8" tubing. Laid down bit. Rigged up wireline. Ran and set 7" CIBP at 5600' with 35' of Class "C" cement on top. RIH w/2-7/8" tubing to 5550'. Spotted 76 bbls plug mud from 5550-3500' (in 7" casing). POOH with 2-7/8" tubing to 1500'. Shut down for night. NOTE: Notified Jack Griffin w/OCD of bridge plug setting.

8-17-94 - POOH and laid down tubing. Nippled down BOP and wellhead. Welded on 7" pull nipple. Rigged up casing jacks. Pulled slips - 250000# max pull. Took casing stretch. Estimate free point at 2830'. Rigged up wireline truck. Picked up 6" casing cutter. RIH. Tagged at 2360'. Would not go any further down. POOH. Laid down 6" cutter. Picked up

CONTINUED

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Production Clerk DATE 8-22-94
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505-748-1471

(This space for State Use)

APPROVED BY

TITLE

DATE