Submit 3 Copies to Appropriate District Office	Energy, Minerals and Natural Reso		R	evised 1-1-89
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CUNSERVATION P.O. Box 2088	DIVISION	WELL API NO. 30-025-31673	
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New Mexico 8	7504-2088	5. Indicate Type of Lease STATE	X FEE
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410		•	6. State Oil & Gas Lease No. V-3273	
(DO NOT USE THIS FORM FOR PR DIFFERENT RESE (FORM C	ICES AND REPORTS ON WELL OPOSALS TO DRILL OR TO DEEPEN O RVOIR. USE "APPLICATION FOR PERI 2-101) FOR SUCH PROPOSALS.)	H PLUG BACK TO A	7. Lease Name or Unit Agreeme	nt Name
1. Type of Well: OL GAS WELL XX WELL	OTHER		Eidson Ranch	Unit
2. Name of Operator			8. Well No.	
YATES PETROLEUM CORPORATION			9. Pool name or Wildcat	
3. Address of Operator 105 South Fourth Street - Artesia, NM 88210			Arab-C San Andres	
4. Well Location Unit Letter R: 1980 Feet From The South Line and 1650 Feet From The East Line				
Section 5	Township 16S Rar	ge 33E	NMPM Lea	County
	10. Elevation (Show whether 1 4421	GR		
11. Check	Appropriate Box to Indicate N	lature of Notice, F	Report, or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:				
		REMEDIAL WORK		
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT				
			_	
OTHER:		OTHER:		
12. Describe Proposed or Completed Operations (Clearly state all periment details, and give periment dates, including estimated date of starting any proposed work) SEE RULE 1103. weight bar with 5-3/4" swedge. RIH to 3600'. Did not tag anything. POOH. Laid down weight bar and swedge. Picked up 6" cutter with 14' of weight bars. Ran and cut 7" casing at 3500' with jet cutter. Rigged down wireline. Picked up and worked 7" casing for 3 hours to 205000# max with pump. Pressured up to 1200#. No loss in 30 minutes. Rigged up wireline truck. Ran and cut 7" casing with 6" jet cutter at 2800'. Rigged down wireline. Picked up on casing. Worked up to 200000#. Rigged up pump. Pumped 50 bbls water at 2 BPM. At 950# casing came free. Rigged up casing equipment. POOH. Laid down 11 joints of 7" casing. Shut down for night. NOTE: Notified Paul with OCD in Hobbs of casing cut. 8-18-94 - Laid down 7" casing. Rig down casing equipment. Nippled up BOP and wellhead. RIH with 2-7/8" tubing to 3550'. Mix and pump 35 sacks Class C cement from 3550-3450' (in 7" casing). POOH with 2-7/8" tubing to 2826'. Mix and pump 40 sacks Class C 2% CaCl2 cement from 2826' (in 7" casing) to 2726' (in 8-3/4" hole). POOH with 2-7/8" tubing to 2685'. Reverse circulate clean. WOC 3 hours. RIH w/2-7/8" tubing. Tag CONTINUED I hereby certly that the formation above is tok and complete to the best of my knowledge and belied. SIGNATURE WOR RUSTY Klein THE Production Clerk part 8-22-94 505-748-1471				
(This space for State Use)				
ATTROVED BY		Π.E	DATE	

HEGHNIC

AUCA

OFFICE