

OIL CONSERVATION DIVISION

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-025-31673
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V-3273
7. Lease Name or Unit Agreement Name Eidson Ranch Unit
8. Well No. 4
9. Pool name or Wildcat Arab-C San Andres

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator YATES PETROLEUM CORPORATION	3. Address of Operator 105 South Fourth Street - Artesia, NM 88210	4. Well Location Unit Letter R : 1980 Feet From The South Line and 1650 Feet From The East Line Section 5 Township 16S Range 33E NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4421' GR			

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

top of cement at 2640'. NOTE: Jack Griffin w/OCD - Hobbs okayed plug. POOH with tubing to 2580'. Spotted 200 bbls plug mud from 2580' to surface. POOH with tubing to 1520'. Mix and pump 50 sacks Class C 2% CaCl2 cement from 1520' (in 8-3/4" hole) to 1366' (in 9-5/8" casing). POOH with 2-7/8" tubing. Shut down for night.
8-19-94 - RIH w/2-7/8" tubing. Tag top of cement at 1379'. POOH and laid down 2-7/8" tubing to 40'. Mix and pump 10 sacks Class C cement from 40' to surface (in 9-5/8" casing). POOH and laid down tubing. Nippled down BOP. Rigged down pulling unit. Installed regulation abandonment marker. NOTE: Jack Griffin w/OCD - Hobbs witnessed all plugs. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 8-18-94.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Production Clerk DATE 8-22-94
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505-748-1471

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

RECEIVED

AUG 21 1964

OLD BURNING
OFFICE