

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-32002																				
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>																				
2. Name of Operator Mitchell Energy Corporation		6. State Oil & Gas Lease No. VA-683																				
3. Address of Operator Box 4000, The Woodlands, TX 77387		7. Lease Name or Unit Agreement Name Sombrero "18" State																				
4. Well Location Unit Letter <u>E</u> : <u>1900</u> Feet From The <u>North</u> Line and <u>710</u> Feet From The <u>West</u> Line Section <u>18</u> Township <u>16S</u> Range <u>34E</u> NMPM Lea County		8. Well No. 1																				
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4153' GL		9. Pool name or Wildcat S. Kemnitz (Morrow)																				
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data																						
<table border="0"><tr><td colspan="2">NOTICE OF INTENTION TO:</td><td colspan="2">SUBSEQUENT REPORT OF:</td></tr><tr><td>PERFORM REMEDIAL WORK <input type="checkbox"/></td><td>PLUG AND ABANDON <input type="checkbox"/></td><td>REMEDIAL WORK <input type="checkbox"/></td><td>ALTERING CASING <input type="checkbox"/></td></tr><tr><td>TEMPORARILY ABANDON <input type="checkbox"/></td><td>CHANGE PLANS <input type="checkbox"/></td><td>COMMENCE DRILLING OPNS. <input type="checkbox"/></td><td>PLUG AND ABANDONMENT <input checked="" type="checkbox"/></td></tr><tr><td>PULL OR ALTER CASING <input type="checkbox"/></td><td></td><td>CASING TEST AND CEMENT JOB <input type="checkbox"/></td><td></td></tr><tr><td>OTHER: <input type="checkbox"/></td><td></td><td>OTHER: <input type="checkbox"/></td><td></td></tr></table>			NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:		PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>	TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>		OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:																				
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>																			
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>																			
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>																				
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>																				
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.																						

12/15-16/93 POOH w/tbg. Set CIBP @ 10,000' & cap w/35' of cmt. RIH w/tbg & displ hole w/9.5 ppg mud. POOH w/tbg.  
12/17-18 Cut 5 1/2" csg @ 5250' & POOH w/csg. RIH w/tbg to 8425'.  
12/21 Spot 25 sx plug @ 8425'. PU to 5300' & spot 25 sx plug. PU to 4300'.  
12/22 Tbg stuck. Cut tbg @ 3560'. POOH. RIH w/wash pipe & tbg.  
12/23 Tagged cmt @ 3568'. Mill over tbg to 3661'. Circ clean. POOH. RIH w/overshot & latch onto fish. POOH w/fish.  
12/24 RIH w/tbg to 5300'. Spot 25 sx plug. POOH.  
12/25 RIH w/tbg & tagged plug @ 5213'. PU to 4600'. Spot 50 sx plug. POOH.  
12/28 RIH w/tbg. Tag plug @ 4472'. PU & spot 36 sx plug @ 2000'. POOH. Cut off bradenhead. Pump 10 sx surface plug. Weld on P&A marker. Clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE James Blount TITLE Engineer DATE 3/3/94  
TYPE OR PRINT NAME James Blount TELEPHONE NO. (915) 682-5396

(This space for State Use)

APPROVED BY Cam W. Hill TITLE OIL & GAS INSPECTOR DATE MAY 02 1994

CONDITIONS OF APPROVAL, IF ANY: