

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-32573

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
ANDERSON 33

8. Well No. 1

9. Pool name or Wildcat
WEST KNOWLES STRAWN

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
ANSON GAS CORPORATION

3. Address of Operator
P O BOX 24060 OKLAHOMA CITY, OK 73124

4. Well Location
SHL Unit Letter J : 2520 Feet From The SOUTH Line and 2310 Feet From The EAST Line
BHL G 2153 NORTH 2383 EAST
Section 33 Township 16S Range 38E NMPM LEA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3707' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5/15/97 MIRU Sierra Well Serv. ND wellhead, NU BOP. RU Wireline. RIH w/gauge ring to 9200'. RIH w/5-1/2" CIBP & set @ 9060' (44' above top perf). TIH & tag CIBP @ 9060', circ w/ 10# MLF. Spot 25 sx cmt on CIBP fr 9060'-8807'. PCH & LD 80 jts tbg to 6532'. Spot 25 sx cmt fr 6532'-6279'. TOH. 5/16/97 ND BOP & tbg head. Weld on 5 1/2" pull nipple, remove csg slips & stretch csg to determine free point. Shows free fr 5800' - 6100'. RU WL. RIH w/jet cutter & cut csg @ 6050' (left 5686' 5-1/2" N-80 csg in hole). RU csg tools. Work csg free, POH & LD 135 jts 5 1/2" csg. 5/17/97 NU tbg head & BOP. TIH w/194 jts 2 7/8" tbg. Spot 65 sx cmt @ 6122'. TOH w/30 jts. WOC 3 hrs. TIH & tag top of cmt plug @ 5857'. LD 49 jts tbg. Spot 60 sx cmt plug @ 4565'. Pull 30 jts. WOC 3 hrs. Tag top of cmt plug @ 4460'. Pull end of tbg to 2190'. Spot 35 sx cmt fr 2190'-2090'. Pull end of tbg to 490'. Spot 35 sx cmt plug fr 490' to 385'. LD all tbg. SDFN. 5/20/97 ND BOP & tbg head. PU 1 jt 2 7/8" tbg. RIH & spot 10 sx cmt surf plug. RDMO Rig & plugging Equipment. Dig out, cut off 9 5/8" wellhead & install marker. Cut off rig anchors 3 1/2' below CL. Back fill pit & cellar.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Daniel W. Fischer TITLE OPERATIONS MANAGER DATE 6/2/97

TYPE OR PRINT NAME DANIEL W. FISCHER TELEPHONE NO. _____

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE JUL 10 1997

CONDITIONS OF APPROVAL, IF ANY: aw