

DISTRICT I
P. O. Box 1980, Hobbs, NM 88240

DISTRICT II
P. O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P. O. Box 2088
Santa Fe, NM 7504-2088

WELL API NO. 30-025-32893
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-2148
7. Lease Name or Unit Agreement Name Caprock Maljamar Unit
8. Well No. 154
9. Pool name or Wildcat Maljamar Grayburg San Andres
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4199' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL <input type="checkbox"/> GAS <input type="checkbox"/> WELL <input type="checkbox"/> WELL <input type="checkbox"/> OTHER TA
2. Name of Operator The Wiser Oil Company
3. Address of Operator P.O. Box 2568 Hobbs, New Mexico
4. Well Location Unit Letter <u>P</u> : <u>1232</u> Feet From The <u>South</u> Line and <u>1247</u> Feet From The <u>East</u> Line Section <u>17</u> Township <u>17S</u> Range <u>33E</u> NMPM <u>Lea</u> County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <u>Temporary Abandon</u> <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

7/03/01 MIRU Tyler Well Service # 103. POH w/rods and pump. ND WH. RU BOP. POH w/2-7/8" tbg. LD BHA. RIH w/4-3/4" bit & 5-1/2" scraper on 2-7/8" tbg. to 4100'. Tagged fill. POH w/2-7/8" tbg. LD tools. RU reverse unit. RIH w/4-3/4" cone bit, bit sub, DC's & 2-7/8" tbg. to 4100'. Cleaned out to 4280'. Circulated clean. POH w/2-7/8" tbg., DC's & bit.

07/05/01 RIH w/tapered mill bit sub, DC's & 2-7/8" tbg. to 4280'. Drilled out to 4282'. POH w/2-7/8" tbg. & DC's. LD mill.

07/06/01 RIH w/5-1/2" RBP & pkr. on 2-7/8" tbg. to 4278'. Set RBP. Pulled to 4200'. Set pkr. RIH & picked up RBP. POH w/ 2-7/8" tbg. LD RBP & pkr.

07/07/01 RIH w/5-1/2" CIBP on 2-7/8" tbg. to 4190'. Set CIBP. Circulated 100 bbls. pkr. fluid. Tested casing annulus to 500# for 30 min. Held ok. LD tbg. & rods. RD BOP. NU WH - 1 jt. 2-7/8" tbg. through WH w/2" ball valve.
Well is TA'D.

This Approval of Temporary
Abandonment Expires 9/26/06

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE <u>Mary Jo Turner</u>	TITLE <u>Production Tech II</u>	DATE <u>August 13, 2001</u>
TYPE OR PRINT NAME <u>Mary Jo Turner</u>		TELEPHONE NO. <u>(505) 392-9797</u>

(This space for State Use)

APPROVED BY GWW TITLE Geologist DATE 8/6/2001