

**DISTRICT I**

P. O. Box 1980, Hobbs, NM 88240

**DISTRICT II**

P. O. Drawer DD, Artesia, NM 88210

**DISTRICT III**

1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P. O. Box 2088  
Santa Fe, NM 7504-2088

WELL API NO.

30-025-32923

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

B-2148

7. Lease Name or Unit Agreement Name

Caprock Maljamar Unit

8. Well No.

140

9. Pool name or Wildcat

Maljamar Grayburg San Andres

**SUNDRY NOTICES AND REPORTS ON WELLS**

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1 Type of Well:

OIL

WELL ☒

GAS

WELL ☐

OTHER

2. Name of Operator

The Wiser Oil Company

3. Address of Operator

P.O. Box 2568 Hobbs, New Mexico

4. Well Location

Unit Letter H : 2618 Feet From The North Line and 88 Feet From The East Line

Section 18 Township 17S Range 33E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4212' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO**

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: Perf. & acidize ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12/09/97 MIRU Pool Well Service. POH w/pump & rods. ND WH. NU BOP. POH w/2-7/8" tbg. RIH w/Keelo socket on 2-7/8" tbg. Tag tight spot @ 4216' & POH.

12/10/97 RIH w/4-3/4" tapered mill on 2-7/8" tbg. Tag @ 4126'. Cut out 2' tight spot POH. RIH w/4 11/16" Keelo socket. Tag @ 4314'. Pull to 4500'. POH w/no recovery. Change slips & RIH tag fish @ 4300'. Work to 4325'. Would not go further. Parted @ 750,000#. POH w/8 7/8" rods.

12/11/97 RIH w/4-3/4" cutrite shoe, wash pipe & 2-7/8" tbg. Tag @ 4502'. Wash to 4507'. Circulate clean. Pull above perfs.

12/12/97 Tag @ 4506'. Wash to 4510'. Circulate clean. Pull up 6 stands.

12/15/97 POH w/tbg., wash pipe & shoe. RIH w/4 11/16" overshot, extension, bumper sub, 3-3/4" jars, DC's & 2-7/8" tbg. Tag & catch fish @ 4502'. Jar & pull loose. Rec. 5' of 2-7/8" tbg. LD all fishing tools.

12/16/97 RIH w/Perf Clean assembly on 2-7/8" tbg. Water wash 4182'-4501'. Acid wash 4501'-4182'. Circulate clean. POH & LD Perf Clean assembly. RIH w/AD-1 pkr. & 2-7/8" tbg. Set pkr. @ 4083'.

12/17/97 HES pump 4000 gals. 15% NE-FE acid w/chemical salt block. ATP 3050# @ 5.5 bpm. MTP 3400# @ 5.4 bpm. Max. Rate 6.9 bpm. 1st block 700#. 2nd block 900#. 3rd block 500#. ISIP 2257#. 5 min. 2271#. 10 min. 2263#. 15 min. 2254#.

12/22/97 Release pkr. & POH w/2-7/8" tbg. LD pkr. RIH w/2-7/8" tbg. ND BOP. NU WH. RIH w/rods & 2-1/2" x 1-3/4" x 20' RHTC pump. Left well pumping to Battery "A".

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TYPE OR PRINT NAME Mary Jo Turner

TITLE Production Tech II

DATE November 25, 2001

TELEPHONE NO. (505) 392-9797

(This space for State Use)

APPROVED BY

TITLE

DATE JAN 30 2002